

B42 B1A T1AY



 
**KENWORTH TRUCKS**  
A DIVISION OF **PACCAR** AUSTRALIA PTY. LTD.

A.B.N. 43 004 669 667

64 Canterbury Road, Bayswater  
P.O. Box 60, Bayswater, Victoria 3153, Australia  
Telephone: (03) 9721 1500  
Fax: (03) 9720 4144



July 12, 2018



**TO WHOM IT MAY CONCERN**

**Reference: Kenworth VIN 6F500000JA462356**

The current applicable ratings for this vehicle as manufactured by Kenworth Trucks for on-highway permit controlled operations are:

- Gross Train Combination Mass up to and including 110 tonnes and/or
- Gross Vehicle Mass up to and including 26.50 tonnes (Lesser of Component Gross Vehicle Mass up to 27.80 tonnes, or, ADR braking certification Gross Vehicle Mass of 26.5 tonnes)

The vehicle specifications as manufactured by Kenworth Trucks were as follows, shown with current applicable component ratings:

Model	: K200	Date of Manufacture:	June 2018
Engine	: Cummins X15 Euro V 485 - 505	Governed rpm:	2000
Serial Number	: 80057929		
Max Power	: 377 kW @ 1700 rpm		
Max Torque	: 2508 Nm @ 1200 rpm		
Transmission	: Fuller RTLO22918B		
Ratios	: 14.40 12.29 8.51 7.26 6.05 5.16 4.38 3.74 3.20 2.73 2.28 1.94 1.62 1.38 1.17 1.00 0.86 0.73		
Tailshaft	: Meritor RPL25		
Steer Axle	: Meritor MFS731A	Rating:	7300 kilograms
Steering Box	: TRW Ross TAS85	Rating:	8200 kilograms
Front Suspension	: Kenworth Leaf Spring 7.2t	Rating:	7200 kilograms
Steer Tyres	: 295/80R22.5	Rating:	6900 kilograms
Steer Wheels/Rims	: 9.00 x 22.5 285PCD Alloy Wheels	Rating:	7500 kilograms
	<b>Front Axle Assembly (including Steering) Rated</b>		<b>6900 kilograms</b>
		<b>Capacity:</b>	
Drive Axles	: Meritor RT46-160GP	Rating:	20900 kilograms
Drive Axle Ratio	: 4.30		
Rear Suspension	: Kenworth Airglide 460 Tandem, Steel	Rating:	20900 kilograms

This airbag suspension system has been certified as Road-Friendly by the Federal Office of Road Safety (FORS). Certificate No. R1/2012



Drive Tyres	: 11R22.5	Rating:	21800 kilograms
Drive Wheels/Rims	: 8.25 x 22.5 285PCD Alloy Wheels	Rating:	26400 kilograms
Wheelbase	: 4500 mm	<b>Rear Axle Assembly Rated Capacity:</b>	<b>20900 kilograms</b>
Rear Overhang	: 1370 mm	Chassis Section:	270 x 89 x 8mm High Tensile Steel (with rear suspension insert only)

The maximum recommended operating speed is 100 km/h, for which suitable tyres must be fitted. The maximum geared road speed of this vehicle at governed engine rpm is 123 km/h, with this vehicle Road Speed Limited to 100 km/h.

This vehicle was manufactured with an advanced braking/safety system, which included the functions of EBSS (ABS + Automatic Traction Control + Drag Torque Control).

This vehicle was manufactured with an ECER29 compliant cab structure and with a Front Underrun Protection System, in the style of a Temporary FUPS device.

This vehicle was fitted with an Identification Plate (formerly known as the Compliance Plate) in accordance with ADR61. Compliance of the identified Category NC vehicle is confirmed by the Identification Plate Approval Number stamped at the top of the plate.

Individual ADR numbers are not required when an Approval Number is provided, excepting ADR64 (Roadtrains and/or B-Doubles). This compliance, if applicable, is shown on the Vehicle Plate.

This vehicle is certified to ADR64 for Road Train and/or B-Double prime mover use (State permit requirements may be greater than ADR64 standards).

Please note that the above statements :

- do not affect the terms of any existing signed warranty agreement in respect of this Kenworth truck
- are not a separate warranty by Kenworth Trucks
- are not separate application approval for any specific use of this Kenworth truck.

No authorisation exists for other Engineering Signatories to rate or approve this original specification Kenworth truck above the ratings stated in this letter (Vehicle Standards Bulletin No.6, Section 5).

Any modification made after manufacture must be approved under the National Code of Practise for Heavy Vehicle Modifications and if the above ratings do vary, be approved and plated by an Authorised Engineering Examiner.

The National Code of Practise for Heavy Vehicle Modifications (Part A, Section A, 4.4) stipulates that "requirements of the ADR's and original manufacturer's modification guidelines shall take precedence". As Kenworth Trucks offers a wide range of alternative



manufacturer's original specifications, Kenworth Trucks can provide manufacturers ratings for most modifications (National Code of Practise for Heavy Vehicle Modifications, Section S1).

Yours faithfully,  
KENWORTH TRUCKS

A handwritten signature in black ink, appearing to read 'Stefan Farkas', written over a horizontal line.

Stefan Farkas  
Senior Applications Engineer

**Reference: Kenworth VIN 6F5000000JA462356**



# Vehicle History Summary



Fleet #	B42
Registration	BIGTINY
Make	Kenworth
Model	K200
VIN / Chassis #	6F5000000JA462356
Build Date	2018

Date	Reading / Units	Type / Repairer Notes	Repairer
03/02/2026	1,349,245 kms	<b>Cylinder Head</b> R-35298 Bring truck in to workshop and check over. Carry out troubleshooting for reported issues and found leaking intake valve. Removed cylinder head to inspect. Discuss engine repair with customer and opted to proceed with a cylinder head replacement. Fit customers supplied spare cylinder head to block and plumb up. Also replace the below parts during workscope: Thermostat - scored, may seize 3x idler shafts - worn out of spec Turbo wastegate acuator - leaking Cylinder head bolts x11 - corroded/pitted Front cover plug - leaking oil Turbo intake clamp - thread stripping Radiator stay bushes - squashed, cracked Run up and check over. Wash down and road test. Check over and park for collection.	Cummins south pacific
26/10/2025		<b>Auto Electrical Repairs</b> R-34672 Inspected starting fault and found to start sluggish. Tested batteries and found to have faulty battery. Travelled to collect new batteries Removed and replaced all batteries on truck.	AMPED UP TRUCK ELECTRICAL
27/08/2025		<b>DIFF SENSOR, GEARBOX TEMP, PYRO GAUGE, sleeper Air Fault, STARTER FAULTY</b> R-34272 Tested starting fault and found starter motor to not engage after getting warm. Tested all batteries and could not fault. Removed and replaced starter motor with new one. Wired to correct power sources. Tested and could not fault. Tested diff sensor wiring and could not fault. Tested sensors and found faulty. Removed and replaced both diff sensors with new one. Tested and could not fault. Tested pyro gauge and found not working. Tested sensor and found faulty. Removed and replaced with new one and wired to correct power sources. Tested and could not fault. Tested gear box temp sensor and found not working. Tested wiring and could not fault. Removed and replaced sensor and wired to correct power sources. Tested and could not fault. Removed sleeper air control panel and replaced with new updated style. Removed and replaced module. Cut all plugs off wiring at module and wired all to new plugs. Wired to correct power sources. Tested unit and found to come up with oil pressure fault codes. Tested wiring and could not fault. Tested sensor and found wired to wrong	AMPED UP TRUCK ELECTRICAL
27/08/2025		<b>Wheel Alignment</b> T-17575	ELITE TRUCK ALIGNMENTS
14/08/2025	287,406 kms	<b>A - 10,000 - 20,000</b> S-20259 A- SERVICE	Brisbane Workshop
08/08/2025		<b>PRESSURE CHECK</b> T-17872	Bridgestone
05/08/2025		<b>Auto Electrical Repairs</b> R-34086 Auto Electrical work Date: 30/6 Description: After treatment light flashing on intermittently, scan tool on found multiple exhaust temp, sensor faults, checked exhaust temp sensors one looks new traced back to module found plug nit fully seated plugged in active fault code went out, cleared the codes all tested ok	Anmac Services
04/08/2025		<b>DG BAG</b> R-34067 NEW DG BLACK BAG 4/8/2025	Brisbane depot
14/07/2025		<b>Compressor, Receiver Drier</b> R-33948 REPLACED COMPRESSOR AND RECEIVER DRYER VAC PUMPED & FILLED WITH 1.2KG R134A RUN A/C ALL OK DIAGNOSE SLEEPER AIR START FAULT, FOUND RUBBED WIRING, REPAIRED CHECKED STARTING ALL OK REPAIRED REVERSE LIGHT WIRING	PRO TRUCK ELECTRICAL
24/06/2025	1,255,186 kms	<b>A - 10,000 - 20,000</b> S-20150 A-SERVICE INTERCOOLER & ROD BLOW OUR, NEW MUFFLER INSTALL, REPAIRED FRONT GRILL AND TIGHTENED	BRISBANE WORKSHOP

Date	Reading / Units	Type / Repairer Notes	Repairer
20/06/2025		<b>A Service, AXLE, Brake, Hub Seals</b> R-33759 Carried out A Service, rear Front axle R/H/S hub seals & brakes	Brisbane Workshop
17/06/2025		<b>Air Conditioner</b> R-33654 Installed joiner to hose.	Pro Truck Electrical
02/06/2025		<b>Door Module &amp; Regulator, Gauges, Mirror</b> R-33653 Replaced regulator , module & switch on left window, Replace faulty gauges, replaced mirror	Pro Truck Electrical
28/05/2025		<b>Wheel Alignment</b> T-17089 WHEEL ALIGNMENT FRONT & REAR	ELITE TRUCK ALIGNMENTS
07/05/2025		<b>Alternator, Compressor, Drier, Motor, sleeper Air Fault</b> R-33352 Replaced sleeper air motor, compressor,alternator& drier.	Pro Truck Electrical
07/05/2025		<b>Shock Absorbers</b> R-33253 Replaced front shocks	Brisbane Workshop
07/05/2025		<b>Runouts</b> T-16939 2 x RUNOUT 1100R22.5 - RTD - 11.0MM	Bridgestone
06/05/2025	1,513,100 kms	<b>Airbag, Diff, Gearbox, King Pins, Shock Absorbers</b> R-33492 Changed diffs & gearbox filters Replaced king pins Replaced steer & drive shocks Replaced 4 X drive airbags	Brisbane Workshop
06/05/2025	1,513,100 kms	<b>B - 40,000 - 45,000</b> S-19761 B service completed	Brisbane Workshop
24/04/2025		<b>park lights</b> R-33122 Repaired & replaced relay and relay base	Gepps Cross Auto Electrical Pty Ltd
21/03/2025		<b>Fit</b> T-16744 2 x FIT 11006520 - 295/80R22.5 152/148M BS R154	Bandag Adelaide Independent
04/02/2025		<b>Sleeper Air</b> R-32159 Diagnosed & repaired Faulty fan	AB Auto Electrics
06/01/2025	1,530,261 kms	<b>C - Annual</b> S-19146 C service completed	Brisbane Workshop
20/12/2024		<b>Flywheel</b> R-32082 Fly Wheel Machined	Brown and Hurley
18/12/2024	1,185,585 kms	<b>Air Conditioner, Hoses, Receiver Drier</b> R-32083	DSTR Pty Ltd
28/11/2024		<b>Ice Pack</b> R-32081 Ice Pack Shutting down Topped up engine oil, reset set service, supplied a 2.5 litre of oil. Tested all ok	Australian Heavy Diesel
26/11/2024		<b>Mudguards</b> R-31711 R&R 4 X MUDGUARDS. FIT 8 X DRESS STRIPS.	GM Onsite Trailer Maintenance
15/10/2024	1,148,370 kms	<b>A Service</b> R-31239 A service completed	MELBOURNE DIESEL REPAIRS
27/09/2024		<b>Flywheel</b> R-31104 FLYWHEEL MACHINED	Brown and Hurley
19/09/2024		<b>Sleeper Air</b> R-31080 Repaired sleeper air See inv 1291	Australian Heavy Diesel
06/09/2024		<b>Air Conditioner, Blower Motor, Terminals</b> R-31005 R&R blower motor R&R terminals on fuel pump	Pro Truck Electrical

Date	Reading / Units	Type / Repairer Notes	Repairer
22/08/2024	1,125,220 kms	<b>B - 40,000 - 45,000</b> S-18613 B service & repairs completed See TB4739	Brisbane Workshop
13/08/2024		<b>Plug, Suzi Coils</b> R-31004 R&R suzi coils, plugs, EBS lead	Australian Heavy Diesel
11/06/2024	1,085,322 kms	<b>Balance, Fit</b> T-14736 2 X fit 295/80R22.5 BS R154 2 X balance Pos 1, 2 2 X scrap	Bridgestone
06/06/2024	1,082,119 kms	<b>Exhaust Flex</b> R-29877 Replaced Exhaust Flex	Cummins south pacific
20/05/2024	1,070,727 kms	<b>Fuel Filter, Ice Pack</b> R-29701 Serviced Ice Pack Replaced Fuel Filter	Australian Heavy Diesel
07/05/2024		<b>Tank Light Wiring</b> R-29510 Repaired Broken Tank Light Wiring	AB Auto Electrics
28/03/2024		<b>Flywheel</b> R-29062 Machined Flywheel	Brown and Hurley
20/03/2024	1,041,906 kms	<b>Fit</b> T-14281 Fit 8x 11R22.5 BS M866 Pos 5,6,7,8,9,10,11,12	Bandag Adelaide Independent
14/03/2024		<b>Compressor, Ice Pack, Receiver Drier, Regas</b> R-29030 Replaced Ice Pack Compressor Replaced Receiver Drier Regas	AB Auto Electrics
24/01/2024		<b>Relay, Switch</b> R-28326 Replaced Faulty Parker Switch and Relays	AB Auto Electrics
12/01/2024	1,000,000 kms	<b>C - Annual</b> S-17671 C service completed	Australian Heavy Diesel
11/01/2024		<b>Radio, Tank Lights</b> R-28224 Repaired Tank Lights Replace Faulty Radio	AB Auto Electrics
16/12/2023	991,102 kms	<b>Heater Taps</b> R-27968 Replaced leaking heater tap	DieselWorx
14/11/2023		<b>Wiper Switch</b> R-27600 Replaced faulty Wiper Switch	Gepps Cross Auto Electrical Pty Ltd
07/11/2023	972,550 kms	<b>B - 40,000 - 45,000</b> S-17326 B service completed	DieselWorx
07/11/2023	972,550 kms	<b>Fault Codes, Steps</b> R-27498 Replaced Cab Access Steps Scanned for Fault Codes	DieselWorx
13/10/2023		<b>Balance Beads, Refit</b> T-13525 Fit 1x 195/80R22.5 Runout Pos 1 Fit Balance Beads	Bandag Adelaide Independent
12/10/2023		<b>Wheel Alignment</b> R-27135 Wheel Alignment	Hancock and Just
13/09/2023		<b>Air Compressor, Coolant</b> R-26705 RnR Faulty Air Compressor Replace Coolant	MELBOURNE DIESEL REPAIRS
01/09/2023		<b>Fault Codes, Oil Pressure Sensor</b> R-26621 Replaced Oil Pressure Sensor cleared fault codes	DieselWorx
30/08/2023		<b>Cooling System</b> R-26558	MELBOURNE DIESEL REPAIRS

Date	Reading / Units	Type / Repairer Notes	Repairer
		Top up cooling system	
25/08/2023	938,087 kms	<b>B - 40,000 - 45,000</b> S-16977 B service completed	DieselWorx
25/08/2023	938,087 kms	<b>Dash Bulbs, Shock Absorber Rubbers, Windscreen Washer</b> R-26540 Replaced Blown Dash Globes Windscreen Washer not working, clean contacts on Switch Replaced Drive Shock Bushes	DieselWorx
28/06/2023		<b>Engine Oil</b> R-26015 Top up Engine oil as it was very low	Anmac Services
23/06/2023		<b>Coolant, Heater Core</b> R-25820 RnR Heater core Fill Coolant	DieselWorx
07/06/2023		<b>Marker Lights</b> R-25612 Replaced Faulty Marker Light	Pro Truck Electrical
07/06/2023		<b>Anderson Plug</b> R-25594 Supply and install Anderson Plug circuit	Pro Truck Electrical
30/05/2023		<b>Heater, Starter Motor</b> R-25406 replaced lug on starter repaired heater fault	Pro Truck Electrical
26/05/2023		<b>Bushes, Steer Hubs, Tank Light, Tie Rod Ends</b> R-25436 see attached invoice R6766	Brisbane Workshop
26/05/2023	899,788 kms	<b>Wheel Alignment</b> R-25285 See attached INV9733	Fortuna Straightline Engineering
17/04/2023		<b>Adblue Filter</b> R-25502 Adblue filter Oring not seated correctly, replaced filter and Oring	DieselWorx
14/04/2023	879,875 kms	<b>Alternator</b> R-25398 R&R alternator	Pro Truck Electrical
13/04/2023	880,232 kms	<b>Brakes , Shock Absorbers</b> R-24871 Re lined rear axle, new brake shoes New front & rear LH shockies	Brisbane Workshop
13/04/2023	880,232 kms	<b>B - 40,000 - 45,000</b> S-16373 B service completed	Brisbane Workshop
29/03/2023		<b>Fit</b> T-12767 Fit 2x 295/80R22.5 152/148M BS R154 Pos 1,2	Bridgestone
29/03/2023	871,466 kms	<b>Jump Start</b> R-24593 Truck wouldn't start. Connect jumper leads to start truck	Western Truck Group
29/03/2023		<b>Seat</b> R-24591 Supply & fit 6860 seat	SEATS R US
29/03/2023	872,351 kms	<b>C - Annual</b> S-16202 C service completed	Brisbane Workshop
22/02/2023		<b>Callout, Fit</b> T-12627 Fit 1x 11R22.5 148/145L BS M749II EC Pos 10	Bridgestone
17/02/2023	861,036 kms	<b>After Treatment</b> R-24526 Diagnose after treatment fault	Mildura Truck Centre
15/02/2023	861,002 kms	<b>NOX Sensor</b> R-25399 Refer to attached invoice 9745593	Cummins south pacific

Date	Reading / Units	Type / Repairer Notes	Repairer
10/01/2023	839,512 kms	<b>Air Filter</b> R-24007 Replace air filters	Brisbane Workshop
10/01/2023	839,512 kms	<b>B - 40,000 - 45,000</b> S-15809 B Service Completed	Brisbane Workshop
09/12/2022		<b>Sleeper Air</b> R-23526 Diagnose sleeper air fault, found broken wire on compressor, connect gauges and checked pressures all ok	Pro Truck Electrical
08/12/2022		<b>Sleeper Air</b> R-23514 Diagnose sleeper air fault. Replaced evap temp in and out sensors. Found one faulty and one intermittent, Rin sleeper air and confirm compressor cycles.	Pro Truck Electrical
30/11/2022		<b>Alternator, Fan Belt</b> R-23422 R&R Alternator & fan belt	DieselWorx
21/11/2022	812,835 kms	<b>Hub Caps</b> R-23277 Fit drive hubcap	Brisbane Workshop
16/11/2022		<b>Auto Electrical</b> R-23120 No gas in sleep air found leaking #8 hose, replaced drier, check operation	Pro Truck Electrical
04/11/2022		<b>Windscreen Replacement</b> R-23014 Supply & fit RH & LH side windscreen	Alpha Glass Aust P/L
04/11/2022	1 kms	<b>B - 40,000 - 45,000</b> S-15552 B Service Completed No KM's have been recorded at the time of the service	Brisbane Workshop
06/10/2022		<b>Electrical Fault</b> R-22506 CARRY OUT REPAIR AS PER PT-9634 ATTACHED	Pro Truck Electrical
14/09/2022		<b>Adblue Filter, AdBlue Pump, Fault Codes</b> R-22635 See attached INV L31020009	CMV Truck and Bus
06/08/2022	746,909 kms	<b>Adblue fault</b> R-22268 R&R broken hose for ad blue injector, cleaned injector	Brown and Hurley
22/07/2022		<b>Battery</b> R-22133 R&R BATTERIES	AB Auto Electrics
21/07/2022		<b>Sleeper Air</b> R-22161 SLEEPER AIR FAN CONTROLLER FAULTY - ORDERED A NEW ONE	Pro Truck Electrical
18/07/2022	737,882 kms	<b>B - 40,000 - 45,000</b> S-14869 B service completed	Brisbane Workshop
01/07/2022	725,548 kms	<b>Heater Taps</b> R-21721 HEATER NOT WORKING - TAP NOT OPEN - OPENED TAP.	Pro Truck Electrical
28/06/2022	728,084 kms	<b>Heater</b> R-21775 REPLACE HEATER CONTROL BOX	DieselWorx
27/06/2022		<b>Fit</b> T-11701 8 X 11R225 B/STONE M766 FIT POS 3,4,5,6,7,8,9,10	Bandag Adelaide Independent
11/05/2022		<b>Heater</b> R-21271 Repaired & tested stuck blender to heater	Pro Truck Electrical
27/04/2022	696,485 kms	<b>Brake Booster, Governor valve, Grease &amp; Safety Check</b> R-21320 Safety check completed R&R RF brake booster R&R leaking governor valve	DieselWorx
06/04/2022	702,223 kms	<b>Air Intake, Dash Bulbs, Locks</b> R-21234	Brisbane Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
		Replace dash bulbs X 4 Replace door locks & ignition lock Replace RH door lock actuator Replace air intake hat	
31/03/2022		<b>Fuse</b> R-20651 LOCATE AND REPLACE BLOWN FUSE	Pro Truck Electrical
28/03/2022	675,995 kms	<b>Overhead Adjustment</b> R-20673 PERFORM OVERHEAD ADJUSTMENT	Brisbane Workshop
23/03/2022	675,995 kms	<b>General Repairs</b> R-20660 R & R CABIN FILTER REPLACE MATTRESS SERVICE SLEEPER AIR	Brisbane Workshop
17/03/2022	675,985 kms	<b>Air Cleaner</b> R-20443 Replace air cleaners	Brisbane Workshop
17/03/2022	675,985 kms	<b>B - 40,000 - 45,000</b> S-14455 B service completed	Brisbane Workshop
25/02/2022		<b>Electrical Fault</b> R-20204 R & R RELAY	Pro Truck Electrical
24/02/2022	663,331 kms	<b>General Repairs, Vehicle Safety Check</b> R-20585 GENERAL REPAIRS AS PER R5284 / 40754 SAFETY INSPECTION COMPLETED	Brisbane Workshop
24/02/2022		<b>Sleeper Air</b> R-20200 repair sleeper air fault	Pro Truck Electrical
23/02/2022	663,331 kms	<b>General Repairs</b> R-20586 GENERAL REPAIRS AS PER 40754	Brisbane Workshop
28/01/2022	675,376 kms	<b>General Repairs</b> R-20583 GENERAL REPAIRS AS PER R5306 / 40752	Brisbane Workshop
27/01/2022	646,353 kms	<b>General Repairs</b> R-20584 GENERAL REPAIRS AS PER 40752	Brisbane Workshop
10/01/2022	632,904 kms	<b>Beacon Light</b> R-20159 REFIT PLUG AND REFIT DASH - BECON LIGHTS WORKING	Pengelly
07/01/2022	632,735 kms	<b>Bunk Cooler, Coolant Filter</b> R-19797 R&R water/coolant filter Service bunk cooler	Brisbane Workshop
07/01/2022	632,735 kms	<b>B - 40,000 - 45,000</b> S-14193 B service completed	Brisbane Workshop
22/12/2021	622,834 kms	<b>AC Belt, Fan Belt</b> R-20582 R&R FAN BELT R&R AC BELT	Brisbane Workshop
22/12/2021	622,834 kms	<b>General Repairs</b> R-20153 COMPLETE GR AS PER 40751	Brisbane Workshop
29/11/2021	606,995 kms	<b>Vehicle Safety Check</b> R-20072 COMPLETED SAFTEY INSPECTION	Brisbane Workshop
17/11/2021	599,879 kms	<b>C - Annual</b> S-14019 C service completed	Brisbane Workshop
16/11/2021	599,875 kms	<b>Airbag</b> R-20071 REPLACE BROKEN AIRBAG LINE	Brisbane Workshop
01/11/2021		<b>Clutch Adjustment, Grease Lines, Grease &amp; Safety Check</b> R-18812 Safety check Adj Clutch R&R Grease lines left hand steer	Brisbane Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
26/10/2021		<b>Dash lights, Gearbox</b> R-19493 R&R Dash lights Service Gear box and diff's	Brisbane Workshop
25/10/2021	591,255 kms	<b>B - 40,000 - 45,000</b> S-13893 B service completed	Brisbane Workshop
05/10/2021		<b>Alternator, Cigarette Light Fuse, Grease &amp; Safety Check</b> R-19516 Safety check R&R alternator wiring Sower spot lights and replace fuse	Brisbane Workshop
10/09/2021		<b>Intercooler, Vehicle Safety Check</b> R-18809 Safety check R & R Inter cooler Pipe mounts	Brisbane Workshop
07/09/2021		<b>Fit</b> T-11012 2 X 11004496 -295 80/R22.5 152/148M BS R154 FIT POS 1,2	Bridgestone
06/09/2021		<b>Battery</b> R-18810 Replace Batteries	Brisbane Workshop
09/08/2021		<b>Electrical</b> R-18811 R & R Speed sensor wiring	Pro Truck Electrical
27/07/2021	553,706 kms	<b>Gaskets, Heater Taps</b> R-18478 B Service Completed. Replaced Heater tap. Replaced gasket + filler tube hose.	Brisbane Workshop
27/07/2021	553,706 kms	<b>B - 40,000 - 45,000</b> S-13729 B Service Completed. Replaced Heater tap. Replaced gasket + filler tube hose.	Brisbane Workshop
12/07/2021		<b>Lights</b> R-18617 R&R strobe light motor.	Brisbane Workshop
01/06/2021	526,926 kms	<b>Cab Blower</b> R-18102 Fix air line on cab blower	Brisbane Workshop
04/05/2021	519,094 kms	<b>B - 40,000 - 45,000</b> S-13311 B service completed	Brisbane Workshop
04/05/2021	519,094 kms	<b>Air Filter, Grease Lines, Shock Bolt</b> R-17787 Replaced 2 X air filters R&R LH steer shock top bolt Tighten loose grease terminal LF chassis	Brisbane Workshop
16/04/2021	509,357 kms	<b>Air Conditioner</b> R-17720 R&R fan motor R&R drier	Pro Truck Electrical
06/04/2021	489,681 kms	<b>Oil Pressure Sender</b> R-17512 R&R oil pressure senders on motor	Pro Truck Electrical
06/04/2021	502,923 kms	<b>Thermostat</b> R-17621 Replaced thermostat	Pro Truck Electrical
08/03/2021	486,241 kms	<b>Sleeper Air</b> R-17620 Sleeper air belt upside down, flipped over & tested-OK	Pro Truck Electrical
27/02/2021		<b>Exhaust</b> R-17294 Weld pipe back on tank, repair 8" upper clamp, make lower bracket, paint refit stack	RTE
26/02/2021	481,087 kms	<b>B - 40,000 - 45,000</b> S-13084 B service completed	Brisbane Workshop
26/02/2021	481,087 kms	<b>Coolant Filter</b> R-17176 Changed coolant filter & refill coolant	Brisbane Workshop
15/02/2021	470,426 kms	<b>PRESSURE CHECK</b> T-10152	Bridgestone

Date	Reading / Units	Type / Repairer Notes	Repairer
15/02/2021	470,426 kms	<b>Fit, Rotation</b> T-10152 2 X fit 295/80R22.5 152/148M BS R154 Pos 1, 2 7 X fit 11R22.5 146/143L BS M766 Pos 5, 6, 7, 8, 10, 11, 12 2 X rotate Pos 9-9, 9-12	Bridgestone
09/02/2021	472,072 kms	<b>Wheel Alignment</b> T-10110	Bridgestone
12/01/2021	455,678 kms	<b>Tune Up</b> R-16933 Perform overhead adjustment on all valves & jakes (tune up) Nest tune up due at 600000kms	Brisbane Workshop
01/12/2020	441,163 kms	<b>Sleeper Air</b> R-16666 Topped up sleeper air gas	Pro Truck Electrical
25/11/2020	441,163 kms	<b>B - 40,000 - 45,000</b> S-12797 B service completed	Brisbane Workshop
25/11/2020	441,163 kms	<b>Door Seals</b> R-16205 Reglue door seal	Brisbane Workshop
02/11/2020	427,074 kms	<b>Fuel Leak, General Checkover, Sleeper Air</b> R-16667 Check over Serviced sleeper air Repair fuel leak	Brisbane Workshop
02/11/2020	427,074 kms	<b>Puncture</b> T-9537 1 X puncture repair Pos 9	Bridgestone
02/11/2020	427,074 kms	<b>PRESSURE CHECK</b> T-9546	Bridgestone
30/09/2020	406,830 kms	<b>Ignition Switch, Oil Pressure Sensor, Sleeper Air</b> R-15952 Repaired faulty wiring to sleeper air starter motor Repaired faulty wiring to oil pressure sensor R&R ignition switch	Pro Truck Electrical
30/09/2020	411,369 kms	<b>Fit</b> T-9317 2 X fit 295/80R22.5 152/148M BS R154 Pos 1, 2	Bridgestone
28/09/2020	411,369 kms	<b>C - 100,000 -150,000</b> S-12563 C service completed	Brisbane Workshop
18/09/2020	406,830 kms	<b>Belly bar, Diff Oil, Exhaust, Gearbox Oil, Hub Caps, Mudguards, Radiator, Shock Absorbers, Wiper Blades</b> R-15613 Replace diff oils & filter Replace gearbox oil & filter Replaced LH Exhaust clamp Replaced both LHR & RHR mudguards Replace wiper blades Tighten belly bar Tighten LHF steer shocky top mounting bolt Replace both steer shocks Replace LH steer hub cap Blow out radiator	Brisbane Workshop
18/09/2020	406,830 kms	<b>B - 40,000 - 45,000</b> S-12540 B service completed	Brisbane Workshop
19/08/2020		<b>PRESSURE CHECK</b> T-9039	Bridgestone
27/07/2020	382,727 kms	<b>Step</b> R-15950 Fabricate & fit new drivers side step	Crank IT Mechanical
30/06/2020		<b>B - 40,000 - 45,000</b> S-12216 B Service completed	Brisbane Workshop
30/06/2020		<b>Ecowind</b> R-15951 Tune up eco wind	Crank IT Mechanical
30/06/2020	369,220 kms	<b>AC Belt, Air Cleaner, Idler Bearings, Sleeper Air, Tensioner</b> R-14857 Replaced air cleaners. Replaced tensioners and idler bearings. Replaced AC belt Replaced fan belt Serviced sleeper air.	Brisbane Workshop
21/06/2020	362,328 kms	<b>Trailer Brake Release</b> R-15953 Trailer brake hand piece accidentally knocked partially on, released and all good	Butlers Mechanical Port August

Date	Reading / Units	Type / Repairer Notes	Repairer
14/04/2020	327,461 kms	<b>B - 40,000 - 45,000</b> S-11910 B Service Completed	Crank IT Mechanical
07/04/2020	323,246 kms	<b>Door</b> R-14149 RE SECURE BOTTOM DOOR WEDGE	Brisbane Workshop
23/03/2020	313,137 kms	<b>Grease Lines, Tune Up</b> R-13812 Performed overhead adjustment on all valves & jakes (tune up) repaired broken grease line	Crank IT Mechanical
23/03/2020		<b>Fit</b> T-7759 2 X fit 295/80R22.5 152/148M BS R156 Pos 1, 2	Bridgestone
11/02/2020	292,955 kms	<b>Roof</b> R-14026 REMOVE SUN VISOR AND TIGHTEN SUN VISOR MOUNT BOLTS. SEAL AROUND AIR HORN MOUNTS AND REFIT VISOR. HOSE DOWN TO CHECK FOR LEAKS- NOW OKAY	Brisbane Workshop
04/02/2020	288,778 kms	<b>B - 40,000 - 45,000</b> S-11655 B service completed	Brisbane Workshop
04/02/2020	288,778 kms	<b>Shock Mount</b> R-13395 R&R LHF shock mount	Brisbane Workshop
30/01/2020		<b>Battery</b> R-13523 Replaced faulty batteries.	AB Auto Electrics
22/01/2020		<b>Sleeper Air</b> R-13610 Replaced main fuse and holder into sleep air - blown. Cleaned condensor fan and updated sleeper air program. Carried out full sleeper air service - 840hrs.	RTE
02/12/2019	255,335 kms	<b>B - 40,000 - 45,000</b> S-11481 B service completed	Brisbane Workshop
24/10/2019	231,710 kms	<b>Fit</b> T-6918 2 X fit 295/80R22.5 152/148M BS R156	Bridgestone
22/10/2019		<b>Fit, Puncture</b> T-6894 1 X fit 1 X puncture repair	Bridgestone
16/10/2019	231,485 kms	<b>PRESSURE CHECK</b> T-6853	Bridgestone
16/10/2019	231,485 kms	<b>Fit</b> T-6856 8 X fit 11R22.5 146/143L 16 BS M766 Pos 5, 6, 7, 8, 9, 10, 11, 12 1 X scrap	Bridgestone
11/10/2019	227,781 kms	<b>B - 40,000 - 45,000</b> S-11207 B Service completed	Brisbane Workshop
27/09/2019		<b>Air Conditioner, Lights</b> R-12217 R&R sleeper air alternator due to not charging R&R white step lights with red	RTE
19/09/2019	210,000 kms	<b>C - 100,000 -150,000</b> S-11035 C Service completed	Brisbane Workshop
11/09/2019	215,030 kms	<b>Balance, Fit</b> T-6647 2 X fit 295/80R22.5 152/148M BS R156 Pos 1,2	Bridgestone
05/09/2019		<b>Rotation</b> T-6608 2 X Rotate Pos 1-2, 2-1	Bridgestone
21/08/2019	199,298 kms	<b>Indicators</b> R-11808 REPLACED RHS BULLBAR INDICATOR LIGHT ASSY	Brisbane Workshop
21/08/2019	199,298 kms	<b>Diff</b> R-11808	Brisbane Workshop

Date	Reading / Units	Type / Repairer Notes	Repairer
		REPLACED OIL & FILTER FRONT DIFF	
21/08/2019	199,298 kms	<b>Diff</b> R-11808	Brown and Hurley
		REPAIRS TO LEAKING BACK DIFF	
21/08/2019	199,298 kms	<b>B - 30-35kms</b> S-10989	Brisbane Workshop
		B SERVICE COMPLETED	
15/07/2019		<b>PRESSURE CHECK</b> T-6251	Bridgestone
04/07/2019	170,589 kms	<b>B - 30-35kms</b> S-10818	Crank IT Mechanical
		B SERVICE COMPLETED	
14/05/2019	147,037 kms	<b>Fit</b> T-5860	Bridgestone
		8 X SCRAP	
09/05/2019	141,908 kms	<b>Exhaust</b> R-10794	Brisbane Workshop
		TIGHTEN AIR INTAKE PIPES	
09/05/2019	141,908 kms	<b>Dashcam</b> R-10794	Brisbane Workshop
		FIT NEW SAFETY CAMERA	
09/05/2019	141,908 kms	<b>B - 30-35kms</b> S-10524	Brisbane Workshop
		B SERVICE COMPLETED	
09/05/2019	141,908 kms	<b>Mudguards</b> R-10794	Brisbane Workshop
		FIT NEW RHR DRIVE MUD GUARD	
09/05/2019	141,908 kms	<b>Fit</b> T-5809	Bridgestone
01/05/2019		<b>Exhaust</b> R-10690	Brisbane Workshop
		Replace l/h exhaust bracket.	
12/04/2019	126,359 kms	<b>Fit</b> T-5673	Bridgestone
		1 X SCRAP	
04/04/2019	122,235 kms	<b>PRESSURE CHECK</b> T-5607	Bridgestone
28/02/2019	101,423 kms	<b>Fit</b> T-5341	Bridgestone
21/02/2019	96,962 kms	<b>Gearbox</b> R-9920	Brisbane Workshop
		Changed gearbox oil filter. Removed hose fittings into gear box filter housing. Cleaned and realed. Refit fittings. Topped up gearbox oil.	
21/02/2019	91,962 kms	<b>Dashcam</b> R-9987	Brisbane Workshop
		Dash cam not working - screen wont light up and only light that comes on is the power light. Tried to reset unit but still in operable. Replaced with new dashcam, fit memory cards from old unit. Formatted cards & tested - now working.	
25/01/2019	80,209 kms	<b>Tune Up</b> R-9630	Brisbane Workshop
		TUNE UP	
25/01/2019	80,209 kms	<b>Exhaust</b> R-9630	Brisbane Workshop
		REPLACED EXHAUST GASKET & CLAMP AT BOTTOM OF MUFFLER BOX	
25/01/2019	80,209 kms	<b>B - 30-35kms</b> S-10048	Brisbane Workshop
		B SERVICE COMPLETED	
04/01/2019		<b>Wheel Alignment</b> T-4947	Pengelly
21/12/2018		<b>B - 30-35kms</b> S-9951	Consolidated Diesels
		B SERVICE COMPLETED	

Date	Reading / Units	Type / Repairer Notes	Repairer
13/12/2018		<b>Slack Adjuster</b> R-9178 REPLACED RH FRONT DRIVE SLACK ADJUSTER	Brisbane Workshop
13/12/2018		<b>Lights</b> R-9181 SEAL TOP ROOF LIGHTS	Brisbane Workshop
25/09/2018		<b>Fire Extinguisher</b> R-8114 RH Side ABE Flame Guard 1.7kg Feb 2019	Pengelly
25/09/2018		<b>Fire Extinguisher</b> R-8113 Behind CAB Flame Stop 4.5kg May 2027	Pengelly
21/09/2018	9,774 kms	<b>B - 18-22km</b> S-9483 B Service completed	Brisbane Workshop
10/09/2018		<b>C - Annual</b> S-9429 Service created for starting point.	██████████
10/09/2018		I-1647	██████████

Signed: \_\_\_\_\_  
Name: \_\_\_\_\_  
Date: \_\_\_\_\_



# Cummins South Pacific Pty. Ltd.

ABN NO. 42006332949

## WORKSHOP TAX INVOICE

Perth  
PO Box 52  
Welshpool WA 6986  
Ph: 08 9475 8777  
Fax: 08 9475 8666

INVOICE NUMBER

1873059

INVOICE DATE

02/02/26

PAGE

1

### COPY

#### Invoice To

Account Number 1300446

[REDACTED]  
[REDACTED]  
[REDACTED]  
[REDACTED]  
[REDACTED]

#### Customer

[REDACTED]  
[REDACTED]  
[REDACTED]  
[REDACTED]

Engine Model:	SIGNATURE/ISX/QSX	Eng No:	80057929	Equip Make:	KENWORTH
FleetNo:		Reg No:	BIGTINY	Cust Ord NO:	
Date in Service:	09/09/18	KLMS:	1349245	HRS:	19623
Repair Date:	30/10/25	Chassis NO:	462356	Currency:	AUD
C.O.No.	6811931	Work ordNo.	2992037	Facility	550

#### Complaint:

Fit supplied cylinder head

#### Cause:

Cylinder head leaking intake valve

#### Correction:

[REDACTED]  
Engine Number: 80057929  
Chassis Number: 462356  
Registration Number: BIGTINY  
Fleet Number:  
Kilometres: 1349245  
Total Fuel Burn: 790435  
Hours: 19623

#### CORRECTION:

Bring truck in to workshop and check over.  
Carry out troubleshooting for reported issues and found leaking intake valve.  
Removed cylinder head to inspect.  
Discuss engine repair with customer and opted to proceed with a cylinder head replacement.  
Fit customers supplied spare cylinder head to block and plumb up.  
Also replace the below parts during workscope:  
Thermostat - scored, may seize  
3x idler shafts - worn out of spec  
Turbo wastegate acutator - leaking  
Cylinder head bolts x11 - coroded/pitted  
Front cover plug - leaking oil  
Turbo intake clamp - thread stripping  
Radiator stay bushes - squashed, cracked  
Run up and check over.  
Wash down and road test.  
Check over and park for collection.

\*\* Customer to supply genuine Cummins cylinder head as requested. The supplied cylinder head is a second hand component.

COMP 370 DIV A10 FAC 550 WA 999 COT

MCUMMESA

All goods and services provided in line with Cummins Terms and Conditions of Sale

**Payment Terms 30 Days from End of Month**

**Cummins South Pacific Pty. Ltd. WORKSHOP TAX INVOICE**



Perth  
 PO Box 52  
 Welshpool WA 6986  
 Ph: 08 9475 8777  
 Fax: 08 9475 8666

**INVOICE NUMBER** 1873059  
**INVOICE DATE** 02/02/26  
**PAGE** 2

Invoice To  
 Account Number 1300446

**Customer** [REDACTED]

Description	Operation	Unit price	Qty	Extension
<b>Labour</b>				
	3	219.00	32.00	7008.00
<b>LABOUR TOTAL</b>				7008.00
<b>Material</b>				
1324	PREMIUM BLUE 8600 BULK OI	4.39	10	43.90
4034356NX	KIT, TURBOCHARGER ACTUATOR	1264.47	1	1264.47
3686018	SHAFT IDLER	344.75	1	344.75
3686358	SHAFT IDLER	478.86	1	478.86
3680260	SHAFT IDLER	344.51	1	344.51
4318947	THERMOSTAT	242.96	1	242.96
4376339	KIT, UPPER ENGINE GASKET	5493.25	1	5493.25
K221-4992	SPACER	47.57	2	95.14
K264-84	GROMMET, TIE ROD	30.19	2	60.38
94143-0550	CLAMP 134MM - 142MM SPRIN	30.95	1	30.95
3688113	PLUG, GEAR COVER	71.78	1	71.78
4393172	SEAL O RING	22.88	1	22.88
4026684	GASKET OIL PAN	778.37	1	778.37
3678506	SCREW HEXAGON FLANGE HEAD	107.69	11	1184.59
FF5776	FUEL FILTER SPINON	58.32	1	58.32
<b>MATERIAL TOTAL</b>				10515.11
<b>Miscellaneous</b>				
	Environmental Levy	50.00	1.00	50.00
	Consumables	120.00		120.00
<b>MISC TOTAL</b>				170.00
<b>SUB-TOTAL</b>				17693.11
<b>G.S.T</b>				1769.31
<b>INVOICE TOTAL</b>				<b>19462.42</b>

UNCOMPILED