

TAX INVOICE



33 Merkel Street
 Thurgoona New South Wales 2640
 ABN: 62351961773
 Licence: MVRL2162
 AU47506

Tel: 02 6040 5500


Email: accounts@bordertruckrepairs.com,
parts@bordertruckrepairs.com

Tax Invoice Number: 76145

Date: 02/11/2020

Due Date: 07/12/2020

BILL TO:

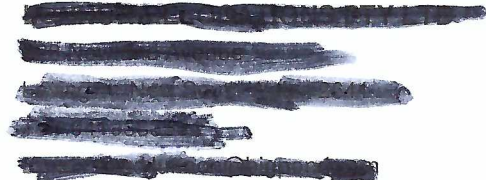

FOR:

Vic roadworthy assessment

Odometer: 48,312 Kms

Make	Model/Year	Body Type	Reg No.	Fleet No.	VIN
Scania	P124/03/02				YS2P6X40001277865

Description	Qty.	Unit Price	Amount
2085822 - Shackle pin	4.0	\$113.64	\$454.56
0182929 - O ring	8.0	\$1.57	\$12.56
0128680 - Bush	4.0	\$113.65	\$454.60
1374326 - Gasket	3.0	\$41.30	\$123.90
0323790 - O ring	1.0	\$31.60	\$31.60
0804670 - O ring	1.0	\$3.97	\$3.97
1762051 - Fuel Pipe	1.0	\$154.70	\$154.70
47149 - BULB 24V/5W TAIL/# PLATE	3.0	\$1.80	\$5.40
grease nipples	3.0	\$1.14	\$3.42
1865752 - Manual slack adjuster rh steer	1.0	\$458.00	\$458.00
1865751 - Slack Adjuster Steer L/H	1.0	\$458.00	\$458.00
FRT1 - FREIGHT PARTS	1.0	\$25.00	\$25.00
1476415 - Air bellow	1.0	\$329.00	\$329.00
0397946 - Transmitter	1.0	\$282.00	\$282.00
FRT1 - FREIGHT PARTS	1.0	\$35.00	\$35.00
1320138 - Diaphram t24	1.0	\$85.60	\$85.60
1871043 - O ring	1.0	\$19.70	\$19.70
1469833 - Repair kit	1.0	\$61.50	\$61.50
1414123 - Carbon brush	1.0	\$40.60	\$40.60
1370248 - Horn button	1.0	\$252.00	\$252.00

Labour	17.3	\$125.00	\$2,162.50
<p>Carry out Victorian roadworthy unhooked the trailer an put the truck over the pit to inspect the oil leak washed off the engine and front springs,</p> <p>remove and replace x2 cam cover gaskets removed the air compressor, starter motor an ecu removed all fuel hoses around the covers removed the two rear covers an cleaned the block off fitted the cam covers with the new gaskets fitted the fuel pump oring an compressor orings fitted the compressor an all pipes fitted the starter motor an ecu/ fuel hoses fitted the missing compressor discharge pipe brackets</p> <p>Remove and replace shackle pins and bushes removed the battery box to remove the pins an bushes removed the rhs toolbox removed the rhs bushes Put new spring bushes in and grease and took off the hoist then clean up the work shop</p> <p>bolted up the battery box an fitted the batteries fitted the rhs toolbox fitted the new hp fuel pipe replaced the rhs booster diagram inspected the air gauge fault</p> <p>carried out fitting of new air supply switch and then once down that i Replace leaking rh hand cab air bag Replaced both steer slack adjusters</p> <p>replaced the horn switch</p>			

	Subtotal	\$5,453.61
	GST	\$545.36
	Total	\$5,998.97
	Paid	\$0.00
	Balance Due	\$5,998.97

When paying by EFT please process payment to: Commonwealth Albury- BSB 062500 A/C: 10143955
Please quote customer code or invoice number
Visa, Mastercard & Eftpos accepted