



39 Bush Inn Road, Wattle Flat, Vic. 3352
 Tel: 5334 5373 Fax: 5334 5550
 Mobile: 0408 715 791
 www.regionalcontractors.com.au
 E-mail: regicon@bigpond.com
 ABN 23 601 333 706

REGIONAL CONTRACTORS
 hire | repairs | sales

SERVICE JOB CARD Job No. _____

Name: _____ Date: 17-7-20
 Address: #V481 + T482
 Phone: _____ Email: _____

Rego/Unit No. DOG TRAILER	Colour:	Type:
Make: V481 TRAILER	Model:	Year:
Kms:	Hours:	Auto/Manual:
Vin/Serial No.	Engine No.	
Service Type:	Service Sheet No.	
Other:		

Jobs Required:

- Repairs/Check over. ✓
- Adjust brakes ✓
- Grease ✓
- Weld up broken air bag. ✓
- Re-wire right side lights ✓
- Replace air lines ✓
- Fit new rear stickers & reflectors. ✓
- Clean trailer. ✓

PROCESSED

Report:

Date	Tech.	Time Taken	RCC	Work Performed

Qty.	Part No.	Description	Charge	Cost
x 4		RED REFLECTORS.		
x 2		WHITE REFLECTORS.		
x 2		DO NOT OVERTAKE STICKERS.		
x 4m		3/8 AIR HOSE		
x 8		HOSE CLAMPS		
x 2		UNI COILS.		
x 4m		SPIRAL WRAP.		
Invoice No.		Invoice Total \$		



39 Bush Inn Road, Wattle Flat, Vic. 3352
Tel: 5334 5373 Fax: 5334 5550
Mobile: 0408 715 791
www.regionalcontractors.com.au
E-mail: regicon@bigpond.com
ABN 23 601 333 706

REGIONAL CONTRACTORS
hire | repairs | sales

SERVICE JOB CARD

Job No. Re 3343

Name: <u>REG CONT.</u>	Date: <u>5-1-18</u>
Address:	
Phone:	Email:

Rego/Unit No. <u>V481</u>	Colour: <u>WHITE/BLUE/RED</u>	Type: <u>TIPPER.</u>
Make: <u>VOLVO</u>	Model: <u>FH12</u>	Year: <u>2002</u>
Kms: <u>917,300</u>	Hours:	Auto/Manual:
Vin/Serial No. <u>YV5A4DBDX1D122707</u>	Engine No. <u>D12C245459</u>	
Service Type: <u>CLASS 2</u>	Service Sheet No. <u>0930</u>	
Other:		

Jobs Required:

SERVICE.

Report:

MUFFLER CLAMP NEEDS REPLACING
AIR FILTER NEEDS REPLACING.



Date	Tech.	Time Taken	RCC	Work Performed
5-1-18	R.A.	4 1/2		CLASS 2 SERVICE CHANGE PTO AIR HOSE TO CORRECT POSITION (SOMEONE HAD SWITCHED HOSES AROUND) TORQUE WHEEL NUTS & FIT HEX CHEX NUT POINTERS.

Qty.	Part No.	Description	Charge	Cost
42 Hr	DIESEL EXTRA LE	ENGINE OIL.		
1	LF3654	OIL FILTER		
2	UF3675	OIL FILTER.		
2	FF5272	FUEL FILTER.		
1	FS 19551	FUEL FILTER/WATER SEP.		
60	B-3038-Y	HEXCHEX WHEEL NUT POINTERS		
1	PA 3839.	POLLEN FILTER.		
Invoice No.	Invoice Total \$			



REGIONAL CONTRACTORS

hire | repairs | sales

39 Bush Inn Road, Wattle Flat, Vic. 3352

Tel: 5334 5373 Fax: 5334 5550

Mobile: 0408 715 791


www.regionalcontractors.com.au

E-mail: regicon@bigpond.com

ABN 23 601 333 706

SERVICE SHEET

0930



Owner: REG. CONT.	Address: WATTLE FLAT.
Make: VOLVO	Model: FH 12 460
Reg: WFW 503	Serial No:
Details:	Type: TIPPER
	Km: 917,300
	Hrs:

SERVICE	CLASS	1	2	3	SERVICE	CLASS	1	2	3	SERVICE	CLASS	1	2	3
ROAD TEST - Check brake operation			✓		BRAKES (ALL) - Adjust ALL Brakes			-		EXHAUST - Check for damage & cond				✗
- Check that indicators self cancel			-		- Check Linings thickness & record below					STEERING - Check Drag Link				✓
- Check for Vibrations					- Front Lining.....%					- Check for Wear or Damage				✓
- Check operation of Clutch			✓		- Front Rear Lining.....%					- Check Tie Rod ends				✓
VEHICLE LIGHTING					- Rear Rear Lining.....%					- Check Steering Knuckles				✓
- Check Headlights / Parkers			✓		- Parking Brake Linings.....%					- Check Steering Box				✓
- Check indicators			✓		- Check parking Brake operation				✓	- Check Steering Box Mounts				✓
- Check Stop lamps			✓		BRAKES (HYDRAULIC)				-	- Check King Pins				✓
- Check Reverse lamps / Beeper			✓		- Brake Adjustment & Operation				-	- Check C/V Knuckles				-
- Check Revolving Lights			✓		- Replace Brake Fluid					WHEELS & TYRES - Check spare tyre				-
- Check Spotlights & Sockets			-		- Check Brake Fluid level				-	- Check Tyre condition				✓
- Check Horn			✓		- Check Brake Hoses & Pipes				-	- Check Tyre pressure				✓
- Check Head Light Alignment					- Remove wheels & check wheel Cyl cond					- Check Nut tension				✓
CABIN - Check seat adjusters			✓		- Brake Adjustment & Operation					BREATHERS - Check Axle				✓
- Check Seat Belts			-		- Air Drier Filter (120,000 km)					- Check Gearbox's				✓
- Check Dash lights, controls & all gauges			✓		- Check Flexible Hoses					BATTERY - Check Clamp & Carrier				✓
- Check Seat Trim			✓		- Check S Cam Bushes					- Check Electrolyte level				-
- Check Fan			✓		WHEEL BEARINGS - Replace hub oil					- Check Leads & Terminals				-
WINDSCREEN - Check Wipers			✓		- Remove / Inspect Hub Seals 120,000 km					GENERAL				
- Check Current Registration Label			✓		- Replace Hub Seals 120,000 km					- Check Mudflaps				✓
- Check Jets			✓		- Front Wheel Hub Oil inspect				✓	- Check operation of Trailer Brake cntrls				
- Top up Reservoir			-		AUTO TRANS - Service					TRUCK MOUNTED WINCH				
- Check Glass			✓		- Check Oil level & condition				-	- Check Mounting Bolts				-
ENGINE - Engine Oil Replace			✓		- Check Neutral Start Switch				-	- Check Clutch Lever Safety Catch				-
- Oil Filter Replace			✓		MIRRORS - Check condition				✓	- Check Oil Leaks				-
- Fuel Filters Replace			✓		CHASSIS - Grease All Points				✓	- Check Fairlead Rollers				-
- Fuel feed Pump Strainer clean			✓		DIFFS - Check Oil level & condition				-	- Check Wire Rope Condition				-
- Drain Water Separator			✓		- Replace Oil					- (pullout & rewind)				✓
- Check Inlet & Exhaust Manifold					SUSPENSION - Check U Bolt tension					- Change Worm Box Oil				-
- Check Engine Drive Belts & Adjustment			✓		- Shackle Pin & Bush condition					- Weight Test				-
- Check Valve Clearances					- Check Hendrickson Bushing					TRUCK MOUNTED CRANE				
- Check Air Filters			✓		- Stabilizer Bars & Bushes					- Check Mounting Bolts				-
COOLING SYSTEM - Replace Coolant					DRIVE SHAFTS - Check Uni Joints				✓	- Check controls operate freely and				
- Check Radiator Condition			✓		- Check Slip joints				✓	Return to Neutral				✓
- Check Inhibitor / Coolant reading			-		- Check Centre Bearings				-	- Check Oil Level in tank				-
- Check Radiator Hoses & Heater Hoses			✓		- Check Mounting Bolts				✓	- Check Shackles & Lifting Hooks				-
- Pressure test			-		SHOCK ABSORBERS - Check mounts				✓	- Check Wire Rope Condition				-
CLUTCH - Check adjustment & operation			✓		- Check for Oil leaks				✓	- Change Oil Filter				
- Check Fluid level & condition			✓		AIR COMPRESSOR & TANKS					- Replace Hydraulic Oil				
- Replace Clutch Fluid					- Check for Air Leaks				✓	- Weight Test				-
POWER STEERING OIL - Check level			✓		- Check Air Tank Drains				✓	- Lubricate All Points				-
- Check condition			✓		- Check Air Gauges					OTHER DEFECTS				-
- Oil & Filter Change every 120,000 km					- Check Air Hoses (ALL)									
GEARBOX / TRANSFER CASE					LABELS - Change Service Label				✓					
- Check Oil level & condition			✓		- Record Service in Service History card				✓					
- Check for Oil Leaks			✓		TOW BARS - Check safety chain locks									
- Replace Oil Gear Box (60,000)			-		- Check Tow Hitch & Pip Pin				✓					
- Replace Transfer Gear Oil			-		- Check Registration Plate condition				✓					

COMMENTS: MUFFLER CLAMP NEEDS REPLACING, AIR FILTER TO BE REPLACED NEXT

SERVICE: _____

MECHANIC: R. APPEBY

SIGNATURE: _____

DATE: 5-1-18



39 Bush Inn Road, Wattle Flat, Vic. 3352
 Tel: 5334 5373 Fax: 5334 5550
 Mobile: 0408 715 791
 www.regionalcontractors.com.au
 E-mail: regicon@bigpond.com
 ABN 23 601 333 706

REGIONAL CONTRACTORS
 hire | repairs | sales

944

SERVICE JOB CARD

Job No. _____

Name: Regional Contractors. Date: 4-9-18
 Address: _____
 Phone: _____ Email: _____

Rego/Unit No. V481/WFW503 Colour: White/blue/Red Type: Tipper
 Make: Volvo Model: FH12 Year: 2002
 Kms: 934545 Hours: _____ ~~Auto~~ Manual:
 Vin/Serial No. YV5A4DBDX1D122707 Engine No. D12C245459
 Service Type: Service + Safety Inspection. Service Sheet No. _____
 Other: 0.5 CLEARANCE LIGHTS & NO PLATE

- Jobs Required:
- 1 HYDRAULIC CAB RELEASE HOSE ✓
 - 2 PTO LEAKING = BAD
 - 3 AFA LEAK AT DRYER
 - 4 EXH MANIFOLD & TURBO LEAK ✓
DO FIRST
 - 5 FAN SHROUD RUBBER !!!
 - 6 ALT BELT 1PK SHORT?
 - 7 CHECK TURBO BRGS RECD
 - 8 AFA BAG PRESS REG LEAK ✓ SEAL
32 x 44
 - 9 ~~REAR SWAY~~ 16.5 mm

Report: VAL TORQUE C4 50

- 10 W 7 PEN HEADS 26" x 2
- 11 REAR SWAY BAR BUSHES
- 12 CLUTCH FEELS TIRED
IB COVER

1521430
1285
~~1521430~~ } 010528

Date	Tech.	Time Taken	RCC	Work Performed
6/9/18	SAY	3 1/2		
7/9/18	SAY	7 1/2		
10/9/18		9 1/2		
11/9/18		7		

Qty.	Part No.	Description	Charge	Cost
42 Ltrs	Diesel extra LE	Engine oil		
1	LF3654	oil filter		
2	LF3675	oil filter		
2	FF5272	Fuel filter		
1	FS19551	Fuel filter/water sep		
1	AF25631	Air filter		
1	AF26162	Air filter		
6	210251	OSHT		
2	150	BATTERIES		
1	125	SPEED SLICK		
1		SEAL		
1		HYDROLYC NOSE		
30L		11 OIL		
		WIPER BLADE		
		SCREEN WASHER		
LOIS		CRUISE		
Invoice No.	Invoice Total \$			

COBURG TRUCK PARTS LAVRTN
 2/180 FAIRBAIRN ROAD
 SUNSHINE WEST VIC 3020
 AUSTRALIA
 Ph: 03 9316 5999 Fax: 03 9314 0388
 ABN 26 116 971 183

COBURG TRUCK PARTS

TAX INVOICE
 Invoice #: 1378742
 Date: 07/09/2018
 Time: 11:51

Invoice To:

CAPRICORN SOCIETY LTD - AUST
 LOCKED BAG 3003
 WEST PERTH WA 6872
 08 6250 9500

Deliver To:

REGIONAL CONTRACTORS
 (MICK TO DELIVER)
 39A BUSH INN ROAD
 WATTLE FLAT VIC 3352

Account: 60168 Customer Order No: 031962 - W1136 Terms: 30 days

Attention: Sales Order No: C311117668 User ID: Mick Tickner

Product/Description	Bin	Product Code	Ordered	Supplied	B/Order	Unit Price	Extended
CTPMT	RRSR		6.00	6.00	0.00	16.00	96.00
2.10251 GASKET, EXHAUST MANIFOLD LOT: 2.10251							
FREIGHT			1.00	1.00	0.00	40.00	40.00
FREIGHT INWARDS & OUTWARDS							
STOCKIST FOR HYATT BEARINGS GATES BELTS, EXXEL & CASTROL CONTACT US FOR YOUR REQUIREMENTS							

V481 VOLVO

MICK TO DELIVER

Sub Total: 136.00
 Tax included in total: 13.60
Invoice Total: 149.60

RETURN OF GOODS
 Goods will not be accepted for credit without prior permission. Invoice Number must be quoted. Claims will not be recognised after 7 days. A 10% restocking fee will apply to all goods returned for CREDIT.

WARRANTY
 Does not apply unless specifically stated on the invoice.

Please Note: Title to the Goods covered by this invoice does not pass until the Invoice Price has been paid in full. Goods accepted are subject to our normal terms and conditions as published on our website below or as provided on request.



REGIONAL CONTRACTORS

Ph. 0408 715 791 hire | repairs | sales | training

www.regionalcontractors.com.au

ABN 23 601 333 706
39 Bush Inn Road, Wattle Flat, VIC 3352
Tel: 03 5334 5550 Fax: 03 5334 5550
email: accounts@regionalcontractors.com.au

SERVICE JOB CARD

Job No: S8549

Rego/Unit No: V481

Job Type: Repair

Reported Date: 18-Feb-2020

VOLVO FH12

Year:

Hrs/kms

95917

Serial No: YV5A4DBDX1D1227
07

Customer: CONSTRUCTION RESOURCES VIC Site:

NICK FAMMARTINO 040954

0409540 668

Problem: Run up/repairs - Reported by Sam Stanton

Job Description:

Jobs Required:

Parts & Labour on Reverse Side

- ✓ - Fill engine oil.
- ✓ - Replace outer air filter.
- ✓ - Replace alternator belt.
- ✓ - Replace rear left air coupling.
- ✓ - Fill hydraulic filter tank.
- ✓ - OIL filter neck ordered.
- ✓ - Rocker cover gasket starting to leak.

PROCESSED

Technician Signature:

Print Name: Brett



REGIONAL CONTRACTORS

Ph. 0408 715 791 hire | repairs | sales | training

www.regionalcontractors.com.au

ABN 23 601 333 706
 39 Bush Inn Road, Wattle Flat, VIC 3352
 Tel: 03 5334 5550 Fax: 03 5334 5550
 email: accounts@regionalcontractors.com.au

AF26162

Seq	Date	Tech.	Time Taken	RCC	Work Performed
1.					
2.					
3.					
4.					
5.					
6.					
7.					
8.					
9.					
10.					
11.					
12.					
13.					
14.					
15.					

Seq	Qty.	Part No.	Description	Charge	Cost
1.	x1	AF25631	OUTER FILTER AIR.		
2.	x1		AIR HOPLING.		
3.	x 80ltm	15068	HYDRAULIC OIL.		
4.	x1 ltr	15w/40	ENGINE OIL.		
5.	x1		ALTERNATOR BELT.		
6.					
7.					
8.					
9.					
10.					
11.					
12.					
13.					
14.					
15.					
16.					
17.					
18.					
19.					
20.					
Invoice No.				Invoice Total\$	

Note.

Technician Signature:

Print Name: Brett



Hydrautech Pty Ltd
 ABN:45 263 139 732
 P.O. Box 213W, Ballarat Vic 3350
 18 Wiltshire Lane, Ballarat Vic 3350
 Phone:03 5336 2266
 Fax:03 5336 2966
 Email:info@hydrautech.net.au

Tax Invoice

Invoice No	282026	Date	17/07/2020 2:11:37PM	Served By	Mandy Franczak
Order No		Cust.PO#			W5141

Invoice To: REGIONAL CONTRACTORS PTY LTD
 PO BOX 1665
 BAKERY HILL VIC 3354

Delivered To:

Trading Terms:Balance due 30th day after EOM

Part#	Description	Units	Price(Ex)	Total(Ex)
DUO MATIC FEM	DUO MATIC FEMALE	1.000	\$95.0000	\$95.00

COPY

Invoice & Account Details

Invoice No	Payment Due	Account No
282026	30/08/2020	4239
Account Manager		
Invoice Received By		
Name	Signature	

Invoice Totals

Sub Total Ex GST	\$95.00
Freight	\$0.00
Tax	\$9.50
Total Inc GST	\$104.50
Owing	\$104.50

Bank Details BSB:013-516 Account:493264396 Account Name:Hydrautech Pty Ltd

Have a nice day
 From the Hydrautech Team



ABN 80 005 633 205

BALLARAT BEARINGS
1017 Latrobe Street
BALLARAT
VIC 3350

Phone: 5336 1111 Fax: 5336 1153
Email: sales@iw.net.au
www.iw.net.au

Tax Invoice
519121

Date: 17/07/2020
Customer Code: 031962
Your Order No: 031962

Sold To:

REGIONAL CONTRACTORS
REGIONAL CONTRACTORS
"CHARGE THROUGH CAPRICORN"
39A BUSHINN ROAD
WATTLE FLAT 3352

Deliver To:

REGIONAL CONTRACTORS
"CHARGE THROUGH CAPRICORN"
39A BUSHINN ROAD
WATTLE FLAT
VIC 3352

Stock Code	Description	Quantity Ordered	Price Ex GST	Total Value ex GST
8PK0955	OptiBelt RBK - Multrib Auto Belt	1.00	35.60	35.60

order number W5144

✓ 4/8/1

Store Pick Up.

COPY ✓ 4/8/1

Salesperson: **Neale Dick**
EFT Payment Details. Bendigo Bank - BSB 633-000 Account - 119699072

Total ex GST: 35.60
GST Value 3.56
Total Value: 39.16

Payment Terms: **Cash on Delivery**

Checked & Packed by Name.....
Date / /



39 Bush Inn Road, Wattle Flat, Vic. 3352
 Tel: 5334 5373 Fax: 5334 5550
 Mobile: 0408 715 791
 www.regionalcontractors.com.au
 E-mail: regicon@bigpond.com
 ABN 23 601 333 706

REGIONAL CONTRACTORS
 hire | repairs | sales

SERVICE JOB CARD

Job No. W13023

Name:	Date: <u>9-12-20</u>
Address:	
Phone:	Email:

Rego/Unit No. <u>V481</u>	Colour:	Type:
Make:	Model:	Year:
Kms: <u>962,182 . 962,818</u>	Hours:	Auto/Manual:
Vin/Serial No. <u>V481</u>	Engine No.	
Service Type:	Service Sheet No.	
Other:		

Jobs Required:

- Replace rear left brake chamber
- ~~Reph~~ - Repair air hose and fitting on middle brakes.
- Needs air filters.
- Repair drivers seat.

PROCESSED *paid*
 15-12-20

Report:

Date	Tech.	Time Taken	RCC	Work Performed
8-12	B.L	7		SERVICE / REPAIRS.
8-12	S.P	5		SERVICE / REPAIRS.

Qty.	Part No.	Description	Charge	Cost
x1	LF17502	ENGINE OIL FILTER		
x2	LF17503	ENGINE OIL FILTER.		
x42	15W/40	ENGINE OIL.		
x1		BRAKE CHAMBER		
x1		AIR HOSE FITTING		
x1	.8	AIR HOSE		
Invoice No.			Invoice Total \$	



39 Bush Inn Road, Wattle Flat, Vic. 3352
 PO Box 1665, Bakery Hill, Vic. 3354
 Tel: (03) 5339 9222 Fax: (03) 5339 9800
 Mobile: 0408 715 791
 www.regionalcontractors.com.au
 Email: accounts@regionalcontractors.com.au
 ABN 23 601 333 706

SERVICE SHEET

0563

Owner: REGI - CON	Address:	
Make:	Model: VOLVO	Type: TIPPER
Reg:	Serial No:	Km: 962,182
Details:	Hrs:	

SERVICE	CLASS	1	2	3	SERVICE	CLASS	1	2	3	SERVICE	CLASS	1	2	3
ROAD TEST - Check brake operation		/			BRAKES (ALL) - Adjust ALL Brakes		/			EXHAUST - Check for damage & cond		/		
- Check that indicators self cancel		/			- Check Linings thickness & record below					STEERING - Check Drag Link				
- Check for Vibrations		/			- Front Lining...% ⁴⁰ ...		/			- Check for Wear or Damage		/		
- Check operation of Clutch		/			- Front Rear Lining...% ⁴⁰ ...		/			- Check Tie Rod ends				
VEHICLE LIGHTING		/			- Rear Rear Lining...% ⁴⁰ ...		/			- Check Steering Knuckles				
- Check Headlights / Parkers		/			- Parking Brake Linings...% ⁴⁰ ...		/			- Check Steering Box				
- Check indicators		/			- Check parking Brake operation		/			- Check Steering Box Mounts				
- Check Stop lamps		/			BRAKES (HYDRAULIC)		/			- Check King Pins				
- Check Reverse lamps / Beeper		/			- Check external signs of Wheel Cyl. leaks		/			- Check C/V Knuckles				
- Check Revolving Lights		/			- Replace Brake Fluid					WHEELS & TYRES - Check spare tyre		/		
- Check Spotlights & Sockets		/			- Check Brake Fluid level		/			- Check Tyre condition		/		
- Check Horn		/			- Check Brake Hoses & Pipes		/			- Check Tyre pressure		/		
- Check Head Light Alignment					- Remove wheels & check wheel Cyl cond					- Check Nut tension		/		
CABIN - Check seat adjusters		/			- Brake Adjustment & Operation					BREATHERS - Check Axle				
- Check Seat Belts		/			- Air Drier Filter (120,000 km)					- Check Gearbox's		/		
- Check Dash lights, controls & all gauges		/			- Check Flexible Hoses					BATTERY - Check Clamp & Carrier		/		
- Check Seat Trim		/			- Check S Cam Bushes					- Check Electrolyte level		/		
- Check Fan		/			WHEEL BEARINGS - Replace hub oil					- Check Leads & Terminals		/		
WINDSCREEN - Check Wipers		/			- Remove / Inspect Hub Seals 120,000 km					GENERAL				
- Check Current Registration Label		/			- Replace Hub Seals 120,000 km					- Check Mudflaps		/		
- Check Jets		/			- Front Wheel Hub Oil inspect					- Check operation of Trailer Brake cntrls				
- Top up Reservoir		/			AUTO TRANS - Service					TRUCK MOUNTED WINCH				
- Check Glass		/			- Check Oil level & condition		/			- Check Mounting Bolts				
ENGINE - Engine Oil Replace	R	/			- Check Neutral Start Switch		/			- Check Clutch Lever Safety Catch				
- Oil Filter Replace	R	/			MIRRORS - Check condition		/			- Check Oil Leaks		/		
- Fuel Filters Replace					CHASSIS - Grease All Points		/			- Check Fairlead Rollers				
- Fuel feed Pump Strainer clean					DIFFS - Check Oil level & condition		/			- Check Wire Rope Condition				
- Drain Water Separator		/			- Replace Oil					- (pullout & rewind)				
- Check Inlet & Exhaust Manifold					SUSPENSION - Check U Bolt tension					- Change Worm Box Oil				
- Check Engine Drive Belts & Adjustment		/			- Shackle Pin & Bush condition					- Weight Test				
- Check Valve Clearances					- Check Hendrickson Bushing					TRUCK MOUNTED CRANE				
- Check Air Filters		/			- Stabilizer Bars & Bushes					- Check Mounting Bolts				
COOLING SYSTEM - Replace Coolant					DRIVE SHAFTS - Check Uni Joints		/			- Check controls operate freely and				
- Check Radiator Condition		/			- Check Slip joints		/			Return to Neutral		/		
- Check Inhibitor / Coolant reading					- Check Centre Bearings		/			- Check Oil Level in tank				
- Check Radiator Hoses & Heater Hoses		/			- Check Mounting Bolts					- Check Shackles & Lifting Hooks		/		
- Pressure test					SHOCK ABSORBERS - Check mounts		/			- Check Wire Rope Condition		/		
CLUTCH - Check adjustment & operation		/			- Check for Oil leaks		/			- Change Oil Filter				
- Check Fluid level & condition		/			AIR COMPRESSOR & TANKS					- Replace Hydraulic Oil				
- Replace Clutch Fluid					- Check for Air Leaks		/			- Weight Test				
POWER STEERING OIL - Check level		/			- Check Air Tank Drains					- Lubricate All Points				
- Check condition		/			- Check Air Gauges					OTHER DEFECTS				
- Oil & Filter Change every 120,000 km					- Check Air Hoses (ALL)									
GEARBOX / TRANSFER CASE		/			LABELS - Change Service Label		/							
- Check Oil level & condition		/			- Record Service in Service History card		/							
- Check for Oil Leaks		/			TOW BARS - Check safety chain locks									
- Replace Oil Gear Box (60,000)					- Check Tow Hitch & Pip Pin		/							
- Replace Transfer Gear Oil					- Check Registration Plate condition		/							

COMMENTS: REPLACE SMASHED BRAKE BOOSTER, REPAIR DAMAGED AIR HOSE & FITTING, REPAIR DAMAGED SEAT.

MECHANIC: BERTT SIGNATURE: *Bertt* DATE: 9-12-20.



REGIONAL CONTRACTORS EQUIPMENT HIRE
POSTAL: P.O. BOX 1665,
BAKERY HILL, VIC 3354
23 SELKIRK DRIVE WENDOUREE VIC 3355
TEL:03 5339 9222 FAX 03 5339 9800
accounts@regionalcontractors.com.au
ABN: 23 601 333 706

SERVICE JOB

Job No: S22320

Stock No: V481 VOLVO TIPPER TRUCK HIRE 12T TIPPER Serial No: YV5A4DBDX1D122707

Customer: FULTON HOGAN INDUSTRIES (BALLARAT DEPOT) Site: 26 KENNEDYS DRIVE DELACOMBE VIC 3356
Phone: 03 5335 9102

Contact: Tony 0429 064 806
Contract: 32053

Job Description: 10,000 KM / 6 Month Service Interval Meter 974445

Work Items: 10,000 KM / 6 Month Service Interval 12/7/22

Category	Stock No	Qty	Unit Cost	Description	Order No
----------	----------	-----	-----------	-------------	----------

~~PO for service issued LD McKenzie P 97796 7/7/22~~

10,000km completed by LD McKenzie.

PROCESSED

Engineer Signature: [Signature] Date: _____ Raised By: PETER SHAW
Print Name: PETER _____ Date: 8/07/2022

Seq	Date	Tech	Time Taken	RCC	Work Performed
1	 	 			
2					
3					
4					
5					
6					
7					
8					
9					
10					

Seq	QTY.	Part No.	Description	Charge	Cost
1					
2					
3					
4					
5					
6					
7					
8					
9					
10					
11					
12					
13					
14					
15					
16					
17					
18					
19					

Technician Signature: _____

Print Name: _____



A Bepcor Group Company. ABN 64 163 260 279

Truckline - Ballarat

Unit 1
29 Selkirk Drive
Wendouree VIC 3355

Head Office

P O Box 512
Archerfield QLD 4108
Australia
PH: (07) 3565 4300
FAX: (07) 3565 4398

TAX INVOICE
Invoice No: 7883353
Date: 07/07/2022

Sales: 1300 487 850
www.truckline.com.au

Page 1 of 1

Invoice To:

REGIONAL CONTRACTORS
PO BOX 1665
BAKERY HILL VIC 3354
AUSTRALIA

Deliver To:

REGIONAL CONTRACTORS
23 SELKIRK DRIVE
WENDOUREE VIC 3355
AUSTRALIA

JM

Account: 1300002	Customer Order No: PS9795	Terms: 30 days from EOM				
Sales Person:	Sales Order No: 6453900					
Product/Description	Ordered	Supplied	B/Order	Unit Price	GST	Extended
M1864X6 UNION TEE 6MM QUICK CONNECT	6.00	6.00	0.00	17.16	10.30	113.26

Please Direct Debit to:
Bank: ANZ **BSB:** 013148 **Account:** 838174784 **Name:** SPEC WSALE TRUCKLINE
 Items specially procured will not be accepted for credit.
 Goods returned after 30 days will incur a charge.
 Goods returned after 45 days will not be accepted for a credit.
 Refer to our website for terms and conditions.

Sub Total:	102.96
GST:	10.30
Invoice Total	113.26
	AUD



® Truckline - Ballarat
 Unit 1
 29 Selkirk Drive
 Wendouree VIC 3355

Head Office
 P O Box 512
 Archerfield QLD 4108
 Australia
 PH: (07) 3565 4300
 FAX: (07) 3565 4398

TAX INVOICE
Invoice No: 7885822
Date: 08/07/2022

A Bepcor Group Company. ABN 64 163 260 279

Sales: 1300 487 850
www.truckline.com.au

Page 1 of 1

Invoice To:

REGIONAL CONTRACTORS
 PO BOX 1665
 BAKERY HILL VIC 3354
 AUSTRALIA

Deliver To:

REGIONAL CONTRACTORS
 23 SELKIRK DRIVE
 WENDOUREE VIC 3355
 AUSTRALIA

JM

Account: 1300002	Customer Order No: PS9795	Terms: 30 days from EOM				
Sales Person:	Sales Order No: 6453867					
Product/Description	Ordered	Supplied	B/Order	Unit Price	GST	Extended
X903271 KIT VOLVO FK12B .	1.00	1.00	0.00	97.41	9.74	107.15

Please Direct Debit to:
Bank: ANZ **BSB:** 013148 **Account:** 838174784 **Name:** SPEC WSALE TRUCKLINE
 Items specially procured will not be accepted for credit.
 Goods returned after 30 days will incur a charge.
 Goods returned after 45 days will not be accepted for a credit.
 Refer to our website for terms and conditions.

Sub Total:	97.41
GST:	9.74
Invoice Total	107.15
	AUD

LD Mckenzie contracting

Ballarat
VIC 3352
+61 497536235
ldmckenziecontracting@gmail.com
ABN 89982574624



Tax Invoice

INVOICE TO

Regional Contractors
Regional Contractors
P.O. Box 1665
Bakery Hill Vic 3354

INVOICE NO. 01666

DATE 25/07/2022

DUE DATE 24/08/2022

TERMS Net 30

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
12/07/2022	Onsite Mechanical Services	Carry out lube service and safety check on V481.	3.50	90.00	315.00

REG- WFW903
Assset no- V481
KMs- 974445
PO- PS9796
Thank you for your business!

SUBTOTAL 315.00
GST TOTAL 31.50
TOTAL 346.50
BALANCE DUE **A\$346.50**

BAS SUMMARY

RATE	GST	NET
GST @ 10%	31.50	315.00

V481

Bank Details
Name- Lachlan Mckenzie
BSB- 193-879
ACC- 480014398



39 Bush Inn Road, Wattle Flat, Vic. 3352
 PO Box 1665, Bakery Hill, Vic. 3354
 Tel: (03) 5339 9222 Fax: (03) 5339 9800
 Mobile: 0408 715 791
 www.regionalcontractors.com.au
 Email: accounts@regionalcontractors.com.au
 ABN 23 601 333 706

VEHICLE SERVICE & INSPECTION SHEET


703

Customer / Company:		Date:	
Make / Model: Volvo FH 12	Body Type: Tipper	Reg: WFW 503	Km: 97445
Vin:		Service Type: 10,000	

SERVICE ITEM		SERVICE ITEM		SERVICE	
1 Check operation of all switches & controls	✓	21 Check tyre condition/pressure	✓	41 Check / Adjust clutch	✓
2 Check brake/clutch pedal rubber	✓	22 Check tyre nuts	✓	42 Check ABS/SRS warning system	✓
3 Check operation of car horn & buzzers	✓	23 Remove all road wheels	✓	43 Scan/reset engine for fault codes	✓
4 Check/replace windscreen wiper blades	✓	24 Check wheel bearings/seals	✓	44 Check/replace timing belt	✓
5 Check windscreen for chips & cracks	✓	25 Check drive shafts/universal joints/bearings	✓	45 Check/adjust door & boot locks	✓
6 Check/replace operation of exterior lights	✓	26 Drain engine oil and replace filter	✓	46 Check/lubricate door hinges	✓
7 Check exterior mirrors	✓	27 Replace Sump Plug / Gasket	✓	47 Check automatic transmission	✓
8 Check/replace rear wiper blades	✓	28 Replace air filter	X	48 Check/replace transmission oil & filter	✓
9 Check spare tyre condition	N/A	29 Replace fuel filter	✓	49 Check/replace diff oil	✓
10 Check underside of car for damage	✓	30 Check/replace spark plugs - glow plugs	X	50 Check/replace transfer case oil	✓
11 Check for engine oil leaks	✓	31 Replace/ top up engine coolant	✓	51 Check/replace axel oil seals / gaskets	✓
12 Check for fuel leaks	✓	32 Check/adjust all drive belts	✓	52 Check/replace radiator hoses	✓
13 Check for power steering leaks	✓	33 Check/adjust windscreen washers	✓	53 Check/replace heater hoses	✓
14 Check for coolant leaks	✓	34 Top up windscreen reservoir with additive	X	54 Check/replace radiator cap	✓
15 Check condition of brake hoses/lines	✓	35 Check battery levels and clean terminals	✓	55 Check/adjust Heater Operation	✓
16 Check/replace brake fluid level	✓	36 Check/adjust condition of seat belts	✓	56 Check/adjust Air Conditioning	✓
17 Check/replace power steering fluid level	✓	37 Check/replace brake pads/shoes	✓	57 Pressure Clean	✓
18 Check condition of exhaust system	✓	38 Check/replace/machine brake disc rotors	✓	58 Replace service label	✓
19 Check steering rack/pump/linkages	✓	39 Adjust brake system where necessary	✓	59 Road Test Vehicle	✓
20 Check shocks/springs/mountings	✓	40 Check/adjust handbrake operation	✓	60 Report/recommend further work	✓

CODES: ✓ = Checked / In order R = Replaced A = Adjusted W = Worn
 L = Leaks NR = Needs Repairing D = Damaged N/A = Not Applicable

COMMENTS

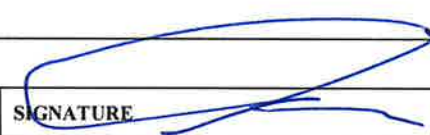MECHANIC	NAME Cokey me	SIGNATURE 	DATE 12-7-22
----------	----------------------	--	---------------------



REGIONAL CONTRACTORS EQUIPMENT HIRE
POSTAL: P.O. BOX 1665,
BAKERY HILL, VIC 3354
23 SELKIRK DRIVE WENDOUREE VIC 3355
TEL:03 5339 9222 FAX 03 5339 9800
accounts@regionalcontractors.com.au
ABN: 23 601 333 706

SERVICE JOB

Job No: S25261

Stock No: V481 VOLVO TIPPER TRUCK HIRE 12T TIPPER Serial No: YV5A4DBDX1D122707

Customer: FULTON HOGAN INDUSTRIES (BALLARAT DEPOT) Site: 26 KENNEDYS DRIVE DELACOMBE VIC 3356
Phone: 03 5335 9102

Contact: Tom Lindsay
Contract: 34183

Job Description: 10,000 KM / 6 Month Service Interval Meter

Work Items: 10,000 KM / 6 Month Service Interval

Category	Stock No	Qty	Unit Cost	Description	Order No
----------	----------	-----	-----------	-------------	----------

LO MCKENZIE - has completed service & repairs

PROCESSED

Engineer Signature: Date: Raised By: breeanna
Print Name: LACHLAN Date: 9/01/2023



REGIONAL CONTRACTORS EQUIPMENT HIRE
POSTAL: P.O. BOX 1665,
BAKERY HILL, VIC 3354
23 SELKIRK DRIVE WENDOUREE VIC 3355
TEL:03 5339 9222 FAX 03 5339 9800
accounts@regionalcontractors.com.au
ABN: 23 601 333 706

SERVICE JOB

Job No: S25261

Stock No: V481 VOLVO TIPPER TRUCK HIRE 12T TIPPER Serial No: YV5A4DBDX1D122707

Customer: FULTON HOGAN INDUSTRIES (BALLARAT DEPOT) Site: 26 KENNEDYS DRIVE DELACOMBE VIC 3356 Phone: 03 5335 9102

Contact: Tom Lindsay
Contract: 34183

Job Description: 10,000 KM / 6 Month Service Interval Meter

Work Items: 10,000 KM / 6 Month Service Interval

Category Stock No Qty Unit Cost Description Order No

LO MCKENZIE - has completed service & repairs - "Carry out. Service, fit new sway bar rubbers to rear, Acid wash aluminium - INV# 01763

PROCESSED

Engineer Signature:

Date:

Raised By: breeanna

Print Name: LACHLAN

Date: 9/01/2023

Seq	Date	Tech	Time Taken	RCC	Work Performed
1					
2					
3					
4					
5					
6					
7					
8					
9					
10					

Seq	QTY.	Part No.	Description	Charge	Cost
1	1X	LD mckenzie	Inv#01763	\$935	
2	1X	SPF0971-26K	sway bar 72mm.		
3	1X	SPFL684K	suspension bar.		
4					
5					
6					
7					
8					
9					
10					
11					
12					
13					
14					
15					
16					
17					
18					
19					

Technician Signature: _____
 Print Name: _____



TRUCKLINE

A Bapcor Group Company. ABN 64 163 280 279

® Truckline - Ballarat

Unit 1
29 Selkirk Drive
Wendouree VIC 3355

Head Office

P O Box 512
Archerfield QLD 4108
Australia
FAX:

TAX INVOICE

Invoice No: 8438332

Date: 12/04/2023

Sales: 1300 487 850
www.truckline.com.au

Page 1 of 1

Invoice To:

REGIONAL CONTRACTORS
PO BOX 1665
BAKERY HILL VIC 3354
AUSTRALIA

Deliver To:

REGIONAL CONTRACTORS
23 SELKIRK DRIVE
WENDOUREE VIC 3355
AUSTRALIA

NH

Account: 1300002 Customer Order No: KR10765 Terms: 30 days from EOM

Sales Person: Sales Order No: 7023478

Product/Description	Ordered	Supplied	B/Order	Unit Price	GST	Extended
BUYSU SUSPENSION SWAY BAR BUSH 72mm ALL 'BUYIN' PRODUCTS ARE NOT REFUNDABLE Lot: 030.116	4.00	4.00	0.00	80.00	32.00	352.00
Qty: 4.00						
BUYSU SUSPENSION SWY BAR BUSH ALL 'BUYIN' PRODUCTS ARE NOT REFUNDABLE Lot: 030.104	4.00	4.00	0.00	72.00	28.80	316.80
Qty: 4.00						

v481

COPY

ENTERED
COPY

+ Lachie McKenzie completed works waiting on Invoice.

Please Direct Debit to:
Bank: ANZ BSB: 013148 Account: 838174784 Name: SPEC WSALE

Items specially procured will not be accepted for credit.
Goods returned after 30 days will incur a charge.
Goods returned after 45 days will not be accepted for a credit.
Refer to our website for terms and conditions.

Sub Total:	608.00
GST:	60.80
Invoice Total	668.80
	AUD

