

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877
ABN: 43 055 375 678

Invoice No: 00006544

Date: 10/02/2021
Job: RA20378
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

TAX INVOICE

Description

Amount

CARRY OUT PERIODIC INSPECTION WITH REFERENCE TO CASA
MAINTENANCE SCHEDULES AND RECTIFICATIONS AS PER ATTACHED
ADDITIONAL WORKSHEET.

LABOUR \$11,103.75

PARTS:

2 x oil filter	\$111.94
4 x gasket	\$5.40
1 x cowl stud	\$6.48
1 x gasket	\$1.44
2 x o ring	\$0.64
8 x bolt	\$3.60
4 x nut	\$15.84
12 x washer	\$1.44
1 x anchor nut	\$1.14
1ft x hose	\$7.56
2 x o ring	\$0.58
1 x o ring	\$0.28
1 x grommet	\$28.44
1 x rivnut	\$0.36
2 x o ring	\$0.58
2 x o ring	\$4.58

Terms: 30 days nett from date of invoice

E & OE

Parts remain the property of
RAPAIR until paid for.

QUERIES relating to this invoice will only be recognised
if received in writing within 14 days of date of invoice.

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

Sub Total

GST

Invoice Total

Paid to Date

Balance Owing

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877
ABN: 43 055 375 678

Invoice No: 00006544

Date: 10/02/2021
Job: RA20378
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

TAX INVOICE

Description	Amount
1 x o ring	\$0.80
2 x seal	\$457.02
4 x seal	\$1,288.56
1 x manifold bracket	\$81.40
1 x tube	\$154.80
1 x pulley	\$56.24
100 x screws	\$28.40
1 x tyre	\$451.44
1 x filter	\$6.50
2 x nut	\$2.90
1 x clevis bolt	\$5.10
14 x nut	\$5.32
1 x cherry rivet	\$0.54
2 x cherry rivet	\$1.10
2 x cherry rivet	\$11.00
3 x screw	\$1.11
1 x battery	\$884.70
acid	\$20.00

AVIONICS:

Terms: 30 days nett from date of invoice

E & OE

Parts remain the property of
RAPAIR until paid for.

QUERIES relating to this invoice will only be recognised
if received in writing within 14 days of date of invoice.

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

Sub Total

GST

Invoice Total

Paid to Date

Balance Owing

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877
ABN: 43 055 375 678

Invoice No: 00006544

Date: 10/02/2021
Job: RA20378
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

TAX INVOICE

Description	Amount
Carry out radio periodic inspection WRT CASA maintenance schedules. Carry out CAO100.5 alt encoder and transponder inspection. Removed transponder for bench check - transponder confirmed u/s on bench, transponder refitted to aircraft and placarded U/S. Investigated co-pilots headset jack. Isolated fault to phones jack. Cleaned and serviced headset jack and ground tested co-pilots jacks, operation normal.	\$430.50
ELECTRICAL & INSTRUMENT: Carry out electrical & instrument periodic inspection WRT CASA maintenance schedules. Fit replacement vacuum relief filters. Visual inspection of heater and components in nose under baggage area. Found heater inoperative - basic fault find, traced to combustion air flow switch, duct temperature switch and vent blower. Heater disabled. Set up and carried out CAO100.5 ASi calibration, pitot static leak check and altimeter inspection.	\$1,634.85
OTHER SERVICES: Weld repair LH & RH turbo support bracket assemblies and pilot's inboard seat bracket assy.	\$384.00
Overhaul, hydrostatically tested blow down bottle S/N 1358T and overhaul regulator, hydrostatically test and fill oxygen bottle.	\$2,420.27
Reweb Qty 1 seat belt as per sample.	\$152.00
Inspect gas strut - unserviceable. Remove and replace gas strut with new item.	\$42.00
OIL	\$241.20

Terms: 30 days nett from date of invoice

E & OE

Parts remain the property of
RAPAIR until paid for.

QUERIES relating to this invoice will only be recognised
if received in writing within 14 days of date of invoice.

BANKING DETAILS: ANZ
BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

Sub Total

GST

Invoice Total

Paid to Date

Balance Owing

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877
ABN: 43 055 375 678

Invoice No: 00006544

Date: 10/02/2021
Job: RA20378
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

TAX INVOICE

Description	Amount
FUEL (842 Litres)	\$1,787.56
CONSUMABLES	\$277.59

Terms: 30 days nett from date of invoice

E & OE

Parts remain the property of
RAPAIR until paid for.

QUERIES relating to this invoice will only be recognised
if received in writing within 14 days of date of invoice.

**BANKING DETAILS: ANZ
BSB # 014 202 A/C # 267 754 928**

Account Name: RapAir Maintenance Pty Ltd

Sub Total \$22,120.95

GST \$2,212.10

Invoice Total \$24,333.05

Paid to Date \$0.00

Balance Owing \$24,333.05

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No HA00378

Rego **JRK CESSNA 414A**

Task Pre-req Insp

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Prepared By CA

Work Required AD/CES/2017-10-09 Amnt 0 NACELLE FITTING INSPECTION AME _____

Time Due Cycles Due LAME [Signature] LIC # 503008 DATE 21/12/2020

Date Due Landings Due 0 Due at AFMS 12523.1 R/N No _____

Action Taken _____

Work Required AD/CES2016-17-08 Amnt 0 ELEVATOR TRIM TAB PUSH/PULL ROD HARDWARE INSP AME _____

Time Due 12,605.5 Cycles Due LAME [Signature] LIC # 596591 DATE 10-11-20

Date Due 17/12/2019 Landings Due 0 AD/CES2016-17-08 Complied with hardware renewal per item #12 additional washers R/N No _____

Action Taken _____

Work Required AD/GEN/87#1 Amnt 0 PRIMARY FLIGHT CONTROL CABLE RENEWAL INS AME H

Time Due Cycles Due LAME [Signature] LIC # 503008 DATE 17/11/20

Date Due 1/11/2018 Landings Due 0 PRIMARY FLIGHT CONTROL CABLE INSPECTION c/o IAW AD/GEN/87 Amnt 1. NO DEFECTS EVIDENT R/N No _____

Action Taken _____

Work Required AIRCON/12 Amnt 4 REQ1 JANAERO HEATER INSP NOTE VDO HRS AME [Signature]

Time Due Cycles Due 100 LAME [Signature] LIC # 545739 DATE 17-11-2020

Date Due 16/11/2017 Landings Due 0 Inspection c/o Nil defects evident R/N No _____

Action Taken _____

Work Required AIRCON/12 Amnt 4 REQ2 JANAERO HEATER TEST NOTE VDO HRS AME [Signature]

Time Due Cycles Due 100 LAME [Signature] LIC # 545739 DATE 17-11-2020

Date Due 16/11/2017 Landings Due 0 Inspection c/o Heater put switch w/s Heater disabled c/o IAW AD/AIRCEN/12 Req 5 R/N No _____

Action Taken _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

4/11/2020

RAPAIR MAINTENANCE PTY LTD
Due in Next 100 Hours, 365 Days, 101 Cycles

Job No HA 00378

Rego **JRK CESSNA 414A**

Task PERIODIC INSPECTION

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Prepared By JA

Work Required AIRCON/12 Amnt 4 REQ3 JANAERO P/SWITCH TEST NOTE VDO HRS AME JA

Time Due Cycles Due 100 LAME JA LIC # 545738 DATE 13-11-2020

Date Due 6/11/2017 Landings Due 0

Action Taken N/A Due P/N. R/N No _____

Work Required AIRCON/12 Amnt 4 REQ4 JANERO HTR OVERHAUL NOTE VDO HRS AME _____

Time Due Cycles Due _____ LAME _____ LIC # _____ DATE _____

Date Due Landings Due 0

Action Taken On condition until failure of decay test. R/N No _____

Work Required AIRCON/13 Amnt 3 KELLY AERO FUEL REG & SHUTOFF VALVES AME JA

Time Due Cycles Due _____ LAME JA LIC # 545738 DATE 17-11-2020

Date Due Landings Due 0

Action Taken Inspection c/o. Nil defects evident. R/N No _____

Work Required ASPEN STBY BAT CHECK Amnt 0 BATTERY CAPACITY TEST AME _____

Time Due Cycles Due _____ LAME _____ LIC # _____ DATE _____

Date Due Landings Due Not applicable 0

Action Taken _____ R/N No _____

Work Required ASPEN STBY BAT REPLACEMENT Amnt 0 RENEW BATTERY AME _____

Time Due Cycles Due _____ LAME _____ LIC # _____ DATE _____

Date Due Landings Due Not applicable 0

Action Taken _____ R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No RA00378
 Task PERIODIC INSPECTION
 Prepared By [Signature]

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Work Required C414 SPEC 15 Amnt 0 BAROMETRIC PRESSURIZATION SWITCH CHECK AME _____

Time Due Cycles Due **Not applicable** LAME _____ LIC # _____ DATE _____

Date Due Landings Due 0 _____ _____ _____

Action Taken R/N No _____

Work Required C414 SPEC 17 Amnt 0 EMCY BLOW DOWN CHECK AME _____

Time Due Cycles Due **Not applicable** LAME _____ LIC # _____ DATE _____

Date Due Landings Due 0 _____ _____ _____

Action Taken R/N No _____

Work Required C414A SID 27-30-01 Amnt 0 ELEV/TORQUE TUBE AME _____

Time Due 13,495.5 Cycles Due ~~_____~~ LAME _____ LIC # 8388 DATE 4/11/2020

Date Due 22/04/2021 Landings Due 0 _____ _____ _____

Action Taken R/N No _____

CPDR PROGRAM TO BE COMPLIED WITH

Work Required C414A SID 32-20-00 Amnt 0 NLG DRAG BRACE AME _____

Time Due Cycles Due ~~_____~~ LAME _____ LIC # 8388 DATE 4/11/2020

Date Due 22/04/2021 Landings Due 12,377 _____ _____ _____

Action Taken R/N No _____

CPDR PROGRAM TO BE COMPLIED WITH

Work Required C414A SID 32-20-01 Amnt 0 NOSE GEAR ATTACH & STRUCTURE AME _____

Time Due Cycles Due ~~_____~~ LAME _____ LIC # 8388 DATE 2/10/2020

Date Due 22/04/2021 Landings Due 12,877 _____ _____ _____

Action Taken R/N No _____

CPDR IN EFFECT

**Maintenance Release
Endorsed**

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No RA 00348

Rego **JRK CESSNA 414A**

Task PERIODIC INS

Hours 12498.9 Cycles 11,877.0 Landings 11,877

For Category - ALL

Prepared By OK

Work Required C414A SID 55-10-03 Amnt 0 HORZ/STAB SPARS & ATTACH AME _____

Time Due 17,249.5 Cycles Due _____ DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 LAME _____ LIC # 80308

Action Taken CROP PROGRAM TO BE COMPLIED WITH R/N No _____

Work Required C414A SID 55-10-04 Amnt 0 HORZ/STAB FWD SPAR INNER CAP AME _____

Time Due 17,249.5 Cycles Due _____ DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 LAME _____ LIC # 80308

Action Taken CROP PROGRAM TO BE COMPLIED WITH R/N No _____

Work Required C414A SID 55-10-05 Amnt 0 HORZ/STAB FWD SPAR LOWER CAP AME _____

Time Due 17,249.5 Cycles Due _____ DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 LAME _____ LIC # 80308

Action Taken CROP PROGRAM TO BE COMPLIED WITH R/N No _____

Work Required C414A SID 55-10-07 Amnt 0 HORZ/STAB REAR SPAR LWR CAP ATTACH AME _____

Time Due 17,249.5 Cycles Due _____ DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 LAME _____ LIC # 80308

Action Taken CROP PROGRAM TO BE COMPLIED WITH R/N No _____

Work Required C414A SID 55-10-08 Amnt 0 HORZ/STAB STAB REAR SPAR UPPER CAP BLO.0 AME _____

Time Due 17,249.5 Cycles Due _____ DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 LAME _____ LIC # 80308

Action Taken CROP PROGRAM TO BE COMPLIED WITH R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No PA00578
 Task Repair not
 Prepared By A

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Work Required C414A SID 55-10-09 Amnt 0 HORZ/STAB REAR SPAR LWR CAP BL 0.0 AME _____

Time Due 17,249.5 Cycles Due _____ LAME _____ LIC # 88888 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 CPDR PROGRAM TO BE COMPLIED WITH R/N No _____

Action Taken _____

Work Required C414A SID 55-20-01 Amnt 0 O/BOARD ELEV HINGE BRACKET&ATTACH AME _____

Time Due 13,495.5 Cycles Due _____ LAME _____ LIC # 88888 DATE 4/11/2020

Date Due 22/04/2021 Landings Due 0 CPDR PROGRAM TO BE COMPLIED WITH R/N No _____

Action Taken _____

Work Required C414A SID 55-30-04 Amnt 0 VERT/STAB REAR SPAR CAP WL108.38 AME _____

Time Due 17,249.5 Cycles Due _____ LAME _____ LIC # 88888 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 CPDR PROGRAM TO BE COMPLIED WITH R/N No _____

Action Taken _____

Work Required C414A SID 56-10-01 Amnt 0 W/SHIELD ATTACH HOLE INSP AME _____

Time Due 12,695.5 Cycles Due _____ LAME _____ LIC # 88888 DATE 4/11/2020

Date Due 23/04/2019 Landings Due 0 CPDR PROGRAM TO BE COMPLIED WITH R/N No _____

Action Taken _____

Work Required C414A SID 57-10-14 Amnt 0 WING LWR C/THERU FRONT SPAR CAP AME _____

Time Due 17,249.5 Cycles Due _____ LAME _____ LIC # 88888 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 CPDR PROGRAM TO BE COMPLIED WITH R/N No _____

Action Taken _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No PA00378

Rego **JRK CESSNA 414A**

Task PERFORM MSB

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL Prepared By JA

Work Required C414A SID 57-10-18 Amnt 0 WING LWR AGT AUX SPAR CAP AME _____

Time Due 17,249.5 Cycles Due _____ LAME [Signature] LIC # 80808 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 COP PROGRAM TO BE COMPLETED WITH R/N No _____

Action Taken _____

Work Required C414A SID 57-10-19 Amnt 0 WING R/SPAR/LWR CAP SPAR SPLICE AME _____

Time Due 17,249.5 Cycles Due _____ LAME [Signature] LIC # 80808 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 COP PROGRAM TO BE COMPLETED WITH R/N No _____

Action Taken _____

Work Required C414A SID 57-10-20 Amnt 0 WING LWR C/THRU REAR S/CAP BL49.50 AME _____

Time Due 17,249.5 Cycles Due _____ LAME [Signature] LIC # 80808 DATE 4/11/2020

Date Due 28/11/2019 Landings Due 0 COP PROGRAM TO BE COMPLETED WITH R/N No _____

Action Taken _____

Work Required C414A SID 57-10-21 Amnt 0 BONDED WING INSPECTION AME _____

Time Due _____ Cycles Due _____ LAME [Signature] LIC # 596594 DATE 9.11.20.

Date Due 23/04/2019 Landings Due 0 INSPECTION C/O IAW SID 57-10-21 R/N No _____

Action Taken _____

Work Required C414A SID 57-10-23 Amnt 0 LWR W/SPAR & SKIN INSP AME _____

Time Due 12,595.5 Cycles Due _____ LAME [Signature] LIC # 80808 DATE 07/12/2020

Date Due _____ Landings Due 0 Maintenance Release Endorsed R/N No _____

Action Taken _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No RA00378
 Task BELOW MSP
 Prepared By JH

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Work Required C414A SID 57-10-25 Amnt 0 WHELL WELL RIB INSP AME _____

Time Due 13,495.5 Cycles Due _____ LAME _____ LIC # 80308 DATE 4/11/2020

Date Due 22/04/2021 Landings Due 0 CLCP PROGRAM TO BE COMPIED WITH. R/N No _____

Action Taken _____

Work Required C414A SID 57-10-26 Amnt 0 UPPER WING C/THRU ATTACH FITTING AME _____

Time Due 13,495.5 Cycles Due _____ LAME _____ LIC # 80308 DATE 4/11/2020

Date Due 22/04/2021 Landings Due 0 CLCP PROGRAM TO BE COMPIED WITH. R/N No _____

Action Taken _____

Work Required CAO 100.5 ASI Amnt 0 ASI CAL INST2013 NO2 APPX 1 AME ✓

Time Due _____ Cycles Due _____ LAME _____ LIC # 86139 DATE 13-11-2020

Date Due 9/11/2019 Landings Due 0 Inspection c/o Nil defects. Aident. R/N No _____

Action Taken _____

Work Required CAO 100.5 COMPASS Amnt 0 COMPASS SWING AC43 AME _____

Time Due _____ Cycles Due _____ LAME _____ LIC # 80308 DATE 2/10/2020

Date Due 17/11/2018 Landings Due 0 Completed with new collection card installed. R/N No _____

Action Taken _____

Work Required CAO 100.5 FUEL CAL Amnt 0 FUEL CAL INST 2013 NO2 APPX1 AME ✓

Time Due _____ Cycles Due _____ LAME _____ LIC # 80308 DATE 13/4/2020

Date Due 16/11/2019 Landings Due 0 FUEL CAL. C/O JAW CAO100.5 FUEL CAL. NIL DEFECTS NOTED. R/N No _____

Action Taken _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

4/11/2020

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

Job No RA 20578

Rego **JRK CESSNA 414A**

Task PERIODIC INSPECTION

Hours 12498.9 Cycles 11,877.0 Landings 11,877

For Category - ALL

Prepared By JA

Work Required CAO 100.5 HSI Amnt 0 HSI/PED SWING AME _____

Time Due Cycles Due LAME [Signature] LIC # 80308 DATE 21/10/2020

Date Due Landings Due 0 HSI UNSERVICEABLE

Action Taken _____ R/N No _____

Work Required CAO 100.5 PITOT STATIC Amnt 0 LEAK CHECK INST 2013 NO2 APPX1 AME [Signature]

Time Due Cycles Due LAME [Signature] LIC # 545738 DATE 13-11-2020

Date Due 16/12/2020 Landings Due 0

Action Taken Inspection c/o Nil defects evident R/N No _____

Work Required CAO 107 Amnt 0 AIRCRAFT REWEIGH AME _____

Time Due Cycles Due LAME [Signature] LIC # 80308 DATE 4/11/2020

Date Due 18/11/2015 Landings Due 0

Action Taken N/A AIRCRAFT PRINTER CUT R/N No _____

Work Required CESSNA400/43 Amnt 8 REQ1 ENG/EXHAUST SYSTEM INSP AME _____

Time Due 12,545.5 Cycles Due Maintenance Release LAME [Signature] LIC # 80308 DATE 21/10/2020

Date Due Landings Due 0 Endorsed

Action Taken _____ R/N No _____

Work Required CESSNA400/43 Amnt 8 REQ2 ENGINE EXHAUST SYSTEM INSP AME [Signature]

Time Due 12,595.5 Cycles Due LAME [Signature] LIC # 80308 DATE 6/11/2020

Date Due Landings Due 0

Action Taken INSPECTION C/O FAW CESSNA400/43 - NIL DEFECTS FOUND. R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No PA00378

Rego **JRK CESSNA 414A**

Task PERIODIC

Hours 12498.9 Cycles 11,877.0

Landings 11,877

For Category - ALL

Prepared By JA

Work Required CESSNA400/92 Amnt 1 W/ FRONT SPAR L/ATTACH FITTINGS AME _____

Time Due 12,595.5 Cycles Due _____

Date Due 17/12/2019 Landings Due 0 LAME JA LIC # 596594 DATE 9.11.20

Action Taken INSPECTION C/O NIL DEFECTS EVIDENT AT THIS TIME. R/N No _____

Work Required CESSNA400/108 Amnt 1 BONDED WING INSP AME _____

Time Due _____ Cycles Due _____

Date Due 17/12/2019 Landings Due 0 LAME JA LIC # 596594 DATE 9.11.20

Action Taken INSPECTION C/O NIL DEFECTS EVIDENT AT THIS TIME. R/N No _____

Work Required CON/60#4 Amnt 4 FUEL INJECTION LINES AME JA

Time Due 12,595.5 Cycles Due _____

Date Due _____ Landings Due 0 LAME JA LIC # 80808 DATE 6/11/2020

Action Taken INSPECTION C/O FAW CON/60#4 NIL DEFECTS FOUND. R/N No _____

Work Required ENG/4 Amnt 11 LH 1600 HR TBO / 12YRS AME _____

Time Due 13,144.3 Cycles Due _____

Date Due 21/05/2019 Landings Due 0 LAME JA LIC # 80808 DATE 4/11/2020

Action Taken On condition R/N No _____

Work Required ENG/4 Amnt 11 RH 1600 HR TBO AME _____

Time Due 13,456.5 Cycles Due _____

Date Due 12/11/2019 Landings Due 0 LAME JA LIC # 80808 DATE 4/11/2020

Action Taken On condition R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Job No PA00378
 Task PERIODIC MISC

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877 For Category - ALL

Prepared By [Signature]

Work Required ENG/4 Amnt 11 **COMPRESSION LEAK TEST** AME [Signature]

Time Due Cycles Due LAME [Signature] LIC # 80308 DATE 4/11/2020

Date Due Landings Due 0 Action Taken W.P.H. ENG COMPRESSION LEAK TEST C/O FAN ENG/4. NIL DEFECTS. R/N No _____

Work Required FIRE EXTINGUISHER Amnt 0 FIRE EXTINGUISHER 6MTH INSPECTION AME AY

Time Due Cycles Due LAME [Signature] LIC # 596594 DATE 6/11/20

Date Due 17/06/2019 Landings Due 0 Action Taken FIRE EXTINGUISHER 6 MTH INSPECTION C/O. NO DEFECTS EVIDENT. IAW AIRC 34-003 R/N No _____

Work Required FIRE EXTINGUISHER Amnt 0 FIRE EXTH 6MTH INSP MR ENDORSEMENT AME _____

Time Due Cycles Due Maintenance Release Endorsed LAME [Signature] LIC # 80308 DATE 2/10/2020

Date Due 17/06/2019 Landings Due 0 Action Taken _____ R/N No _____

Work Required FIRE EXTINGUISHER Amnt 0 FIRE EXTINGUISHERS RENEW AME AY

Time Due Cycles Due LAME [Signature] LIC # 80308 DATE 6/11/20

Date Due Landings Due 0 Action Taken GET DATE IF INSTALLED. 08/13 R/N No _____

Work Required CAO 100.5 COMP GAS CYLINE Amnt 9 H/DUTY COMPRESSED GAS BOTTLES AME _____

Time Due Cycles Due LAME [Signature] LIC # 596594 DATE 17-11-20

Date Due 15/11/2020 Landings Due 0 Action Taken OXYGEN BOTTLE REGULATOR OVERHAULED BY JOHN CAMERON AIRATION - REMOVE/REFIT REFER TASK # 25 ADDITIONAL W/SHEET R/N No CBS-42468

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877

For Category - ALL

Job No AD0378
 Task Periodic

Prepared By [Signature]

Work Required CAO 100.5 COMP GAS CYLINE Amnt 9 **COMP GAS CYLINDER (BLOW DOWN BOTTLE)** AME [Signature]

Time Due Cycles Due LAME [Signature] LIC # 50308 DATE 17-11-20

Date Due 15/11/2020 Landings Due 0

Action Taken C/O By JOHN CAMERON AVIATION - REF # 24 OF ADDITIONAL W/SHEETS FOR REMOVE/FIT R/N No FB-42474

Work Required CAO100.5 EMERGENCY EXIT Amnt 9 **MR ENDORSE&EMCY EXIT OPERATION** AME _____

Time Due Cycles Due **Maintenance Release** LAME [Signature] LIC # 50308 DATE 21/11/2020

Date Due 17/06/2019 Landings Due **Endorsed**

Action Taken _____ R/N No _____

Work Required CAO100.5 EMERGENCY EXIT Amnt 9 **EMERGENCY EXITS OPERATION** AME AI

Time Due Cycles Due LAME [Signature] LIC # 50308 DATE 18/11/20

Date Due 17/12/2019 Landings Due 0

Action Taken EMERGENCY EXIT OPERATION c/o IAW CAO 100.5 EMERGENCY EXIT Amnt 9. NO DEFECTS EVIDENT R/N No _____

Work Required ICA SEB07-05 REV6 Amnt 6 **SECONDARY SEAT STOP ICA INSP** AME _____

Time Due Cycles Due **Not applicable** LAME _____ LIC # _____ DATE _____

Date Due Landings Due 0

Action Taken _____ R/N No _____

Work Required IFR RADIO INSPECTION Amnt 0 **IAW CASA MAINT SCH** AME [Signature]

Time Due 12,595.5 Cycles Due LAME [Signature] LIC # 545738 DATE 17-11-20

Date Due 17/12/2019 Landings Due 0

Action Taken IFR Radio Inspection Inspection c/o 1 R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877

For Category - ALL

Job No AD575

Task Before ins

Prepared By JA

Work Required CAO 100.5 ALTIMETER Amnt 0 CAL ALTIMETER INST 2012 NO2 APPX1

AME [Signature]

Time Due Cycles Due

Date Due 16/12/2020 Landings Due 0 LAME _____

LIC # 545138 DATE 13-11-2020

Action Taken Inspection c/o Nil defects evident.

R/N No _____

Work Required KEITH AIRCON COMPRESSOR Amnt 0 INSPECT FOR TENSION/WEAR

AME [Signature]

Time Due 12,995.5 Cycles Due

Date Due 17/12/2019 Landings Due 0 LAME _____

LIC # 80308 DATE 11/11/2020

Action Taken INSPECTION C/O PAW 414A SM SECT 13 AIR CON SYSTEM. NIL DEFECTS FOUND

R/N No _____

Work Required KEITH AIRCON EVAP/CONDENSER Amnt 0 INSPECT FOR DIRT

AME [Signature]

Time Due 12,995.5 Cycles Due

Date Due 17/12/2019 Landings Due 0 LAME _____

LIC # 80308 DATE 11/11/2020

Action Taken INSPECTION C/O DIRT CLEANED FROM EVAP/CONDENSER FINS. PAW 414A SM SECT 13

R/N No _____

Work Required KEITH AIRCON SYSTEM COMPARATOR Amnt 0 INSPECT FOR DIRT/DAMAGE

AME [Signature]

Time Due 12,995.5 Cycles Due

Date Due 17/12/2019 Landings Due 0 LAME _____

LIC # 80308 DATE 11/11/2020

Action Taken INSPECTION C/O NIL DEFECTS FOUND. C/O PAW 414A SM SECT 13

R/N No _____

Work Required CAO100.5 PROPELLER Amnt 3 FEATHERING FUNCTIONAL CHECK

AME _____

Time Due Cycles Due

Date Due Landings Due 0 LAME _____

LIC # 80308 DATE 21/10/2020

Action Taken Complied with no defects evident.

R/N No _____

AIRWORTHINESS DIRECTIVE AND SPECIAL INSPECTION COMPLIANCE SHEET

RAPAIR MAINTENANCE PTY LTD

Due in Next 100 Hours, 365 Days, 101 Cycles

4/11/2020

Rego **JRK CESSNA 414A**

Hours 12498.9 Cycles 11,877.0 Landings 11,877

For Category - ALL

Job No 8400378
Task REPAIR
Prepared By AA

Work Required CAO 100.5 ALT RPT/EQUIP. Amnt 0 ALT/ ENCODER INST 2013 NO2 APPX1

AME [Signature]

Time Due Cycles Due LAME [Signature] LIC # 545738 DATE 13-11-2020

Date Due 16/12/2020 Landings Due 0

Action Taken Inspection c/o. Nil defects evident. R/N No _____

Work Required CAO100.5 TRANSPONDER Amnt 2 XPONDER CHECK

AME [Signature]

Time Due Cycles Due LAME [Signature] LIC # 545739 DATE 13-11-2020

Date Due 16/12/2020 Landings Due 0

Action Taken Inspection c/o. Nil defect evident. Transponder Unserviceable, panel Placarded Transponder off. R/N No _____

Work Required VACUM RELIEF VALVE Amnt 0 FILTER RENEWAL

AME [Signature]

Time Due 12,595.5 Cycles Due LAME [Signature] LIC # 545739 DATE 9/11/2020

Date Due 17/12/2019 Landings Due 0

Action Taken Inspection carried out - replacement filters fitted R/N No _____

Category Co-Ordinator Certification For and on Behalf of

I hereby certify for the completion and co-ordination of the above mentioned maintenance.

Certifications are pursuant to CAR 42ZE.

Certificate of Approval No.

LAME [Signature] Lic No. 50800 Date 21/11/2020

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER






RA20578

AEROPLANE TYPE

CH44A

AEROPLANE REGISTRATION VH-

JK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
1.	<i>ALL CDF INSPECTORS TO BE COMPLIED WITH IAW AMM</i>	<i>All CDF operation inspections complied with IAW AMM Section A.</i>			<i>88888</i>	<i>27/12/2020</i>
2.	<i>RH TURBO MOUNT FIREWALL ATTACH BRACKET CORRODED.</i>	<i>NEW BRACKET FITTED IAW 44A SM SECT 9 TURBOCHARGER</i>			<i>88888</i>	<i>9/11/2020</i>
3.	<i>LH TURBO MOUNT FIREWALL ATTACH BRACKET CORRODED</i>	<i>NEW BRACKET FITTED IAW 44A SM SECT 9 TURBOCHARGER</i>			<i>88888</i>	<i>9/11/2020</i>

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed. Co-ordinating Certification (if required). For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA00378 AEROPLANE TYPE CL44A AEROPLANE REGISTRATION VH- JRIC

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. No.	DATE
4	RA ENGINE COWL MISSING FASTENER.	NEW FASTNER AND GROMMIT FITTED IAW E4A SIM SECT 9 ENGINE COWLS.			50808	4/11/2020
5	LA ENGINE, RA EXHAUST AFT ATTACH CLAMP W/G.	NEW CLAMP FITTED IAW E4A SIM SECT. 9 ENGINE EXHAUST SYSTEM.			50808	5/11/2020
6	LA ENGINE AFT UPPER CRANKCASE THRU BOLT LEAKING THROUGH A BOLT NUTS TORQUED. WORK IAW 7510-520-NB STANDARD PRACTICE MM APPENDIX B-1.	NEW O-RING'S FITTED TO TORQUED. WORK IAW 7510-520-NB STANDARD PRACTICE MM APPENDIX B-1.			50808	5/11/2020

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20578 AEROPLANE TYPE CH44A AEROPLANE REGISTRATION VH- JRC

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
2	RA ENGINE RA PROP MINOR SURFACE CORROSION ON BLADES.	CORROSION REMOVED AND TREATED. AREAS PREPPED AND PRIMED AND FINISHED IN WHITE. WORK C/O IAW AC43-13-1B CA 6 SECT 7.			<u>945738</u>	<u>6/11/2020</u>
8	Hourmeter Aircon hourmeter fuse U/S	Fuse replaced. Aircon gnd tested, ops normal.			<u>945738</u>	<u>30-11-2020</u>
9	MINOR SURFACE CORROSION OF INTERNAL FUSE SIGN UNDER AIR CON COMPRESSOR ASSY.	CORROSION REMOVED, AND TREATED. AREA PREPPED AND PRIMED. C/O IAW AC43.13-1B CA 6 SECT 7.			<u>945738</u>	<u>9/11/2020</u>

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....







12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20378 AEROPLANE TYPE C444 AEROPLANE REGISTRATION VH-JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
10	LH + RH AILERONS REMOVED FOR CFCP INSPECTION.	AILERONS REINSTALLED IAW AMM SECTION 5 POST CFCP INSPECTIONS.			596594	17-11-20
11	C/O FITMENT AND SAFETY DUPLICATE INSPECTION OF LH + RH AILERONS.	FITMENT AND SAFETY DUPLICATE INSPECTION OF AILERONS LH + RH C/O		<div data-bbox="1388 662 1915 837" style="border: 1px solid black; padding: 5px;"> DUPLICATE INSPECTION CERTIFICATION CARRIED OUT IAW CAR 42ZE FIRST INSP. SIGN:  Lic. No. 596594 SECOND INSP. SIGN:  Lic. No. 89298 </div>		
12	LH + RH ELEVATORS REMOVED FOR CFCP INSPECTION.	LH + RH ELEVATORS REINSTALLED IAW AMM SECTION 6. TRIM TAB PUSH/ROD HARDWARE REVIEWED AS PER AID/CES 2016-17-08.			596594	10-11-20
13	C/O FITMENT AND SAFETY DUPLICATE INSPECTION OF LH + RH ELEVATORS.	FITMENT AND SAFETY DUPLICATE INSPECTION OF LH + RH ELEVATORS C/O.		<div data-bbox="1388 1101 1915 1260" style="border: 1px solid black; padding: 5px;"> DUPLICATE INSPECTION CERTIFICATION CARRIED OUT IAW CAR 42ZE FIRST INSP. SIGN:  Lic. No. 596594 SECOND INSP. SIGN:  Lic. No. 89298 </div>		

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....
 Form RAP / 001C Rev: Initial Date: Nov. 2013

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20376

AEROPLANE TYPE 414A

AEROPLANE REGISTRATION VH-JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
14	LH + RH WING LOCKER BATCH	NEW DRAIN PIPES FITTED				9/11/2020
	AGGY DRAIN PIPES PERFORMED.	IAW 414A SIM SECT 3 WING				
15	RA WING LOCKER MINOR SURFACE CORROSION ON AFT LOWER INTERNAL SURFACE.	CORROSION REMOVED + TREATED. AREA PREPPED AND PRIMED. WORK C/O IAW AC43.13-1B CH 6 SECT 7.				9/11/2020
16	RUDDER REMOVED FOR CPCP INSPECTION	RUDDER REINSTALLED NEW RUDDER TRIM PUSH/PULL ROD TO AFT TAB HARDWARE IN STALLS ALL WRT AMAN				10-11-20
17		SECTION 7				

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA 203796

AEROPLANE TYPE C44A

AEROPLANE REGISTRATION VH- JAR

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
17	AREA OF EXFOLIATION CORROSION VERTICAL STRAP AFT SPAR AFT SIDE AT UPPER RUDDER HINGE BRACKET	CORROSION MECHANICALLY REMOVED AND TREATED - AREA PREPARED & REPAIRED 1/0 WFT AC 42-13-1B CHAPTER 6 SECTION 7. REFINISHED IN WHITE.			596594	10/11/20
18	FITMENT AND SAFETY DUPLICATE INSPECTION OF RUDDER TO BE C/O.	FITMENT AND SAFETY DUPLICATE INSPECTION OF RUDDER C/O.		<div style="border: 1px solid black; padding: 5px;"> <p style="text-align: center; margin: 0;">DUPLICATE INSPECTION CERTIFICATION CARRIED OUT IAW CAR 42G</p> <p>FIRST INSP. SIGN: Lic. No. 596594</p> <p>SECOND INSP. SIGN: Lic. No. 809298</p> </div>		
19	LH MAIN LANDING GEAR TYRE SIDEWALL'S CRACKED.	NEW TUBE AND TYRE FITTED. BOLT TORQUED. WHEEL FITTED TO LH M/LG. WEAR C/O IAW 914 A.S.M. SECT 4 WHEEL, TIRES AND BARRAGES			809298	11/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404







RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER *RA20378*

AEROPLANE TYPE *C414A*

AEROPLANE REGISTRATION *VH-5BK*

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
20	<i>RH MAIN FUEL TANK FWD FUEL DRAIN LEAKING.</i>	<i>DRAIN REMOVED, FOUND DRAIN MAIN SEAL PERISHED. NEW SEAL FITTED TANK 414 SM SECT 11 MAIN FUEL TANKS</i>			<i>88888</i>	<i>11/11/2020</i>
21	<i>RH MAIN FUEL TANK AFT FUEL DRAIN LEAKING</i>	<i>QUICK DRAIN O-RING PERISHED. NEW O-RING FITTED TANK 414A SM SECT 11 MAIN FUEL TANKS</i>			<i>88888</i>	<i>11/11/2020</i>
22	<i>ELEVATOR PULLEY WORN TO LIMITS.</i>	<i>PULLEY ATTACHED TO AFT SPAR ON ELEV. DOWN CABLE WORN. NEW PULLEY FITTED. WORN C/O TAW 414A SM SECT 6 ELEVATOR CONTROL SYSTEM</i>			<i>88888</i>	<i>13/11/2020</i>

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404

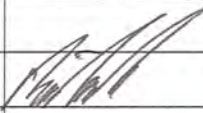
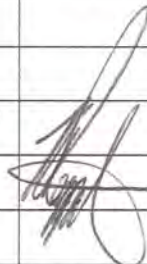

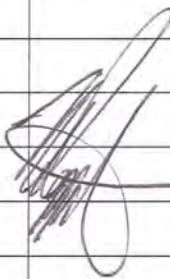
RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20378

AEROPLANE TYPE C414A

AEROPLANE REGISTRATION VH-ORK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
23	MINOR SURFACE CORROSION AROUND CABIN UNDERFLOOR HEATER DUCT.	CORROSION REMOVED AND AREA TREATED. AREA PREPARED AND PRIMED. WORK C/O PAN AC43-13-1B CH 6 SECT 7.			88880	13/11/2020
24	LANDING GEAR BLOW DOWN BOTTLE REMOVED FOR OVERHAUL.	LANDING GEAR BLOW DOWN BOTTLE OVERHAULED BY JOHN CAMPBELL AVIATION ARC # FB 42474 REFERRED AND REINSTALLED WRT AMM SECTION 4 AND SERVICES WRT SECTION 2 OF AMM.			88880	17/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....




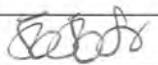
12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RP 20318 AEROPLANE TYPE 414 A AEROPLANE REGISTRATION VH-JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. No.	DATE
25	OXYGEN/REGULATOR ASSY REMOVED FOR OVERHAUL	OXYGEN BOTTLE/REGULATOR ASSY OVERHAULED BY JOHN CAMERON AVIATION AEC # OR-42468 REFERS REINSTALLED WRT AMM SECTION 13.			596594	17/11/20
26	CORRODED RIVETS ON O/R AFT OF RH NACELLE.	CORRODED RIVETS REMOVED AND NEW RIVETS INSTALLED IAW AC 48. 13-16 CHAPTER 4, SECTION 9 FIG 4-57				18/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER *RA20578*

AEROPLANE TYPE *414A*

AEROPLANE REGISTRATION *VH-JRK*

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. No.	DATE
<i>27</i>	<i>CORROSION THROUGH SKIN ON O/R AFT OF LH NACELLE.</i>	<i>CORRODED AREA REMOVED AND AREA TREATED AND PRIMED. INSERT AND DOUBLER PATCH REPAIR INSTALLED. IAW AC 43-13-16 CHAPTER 4 SECTION 4.</i>	<i>[Signature]</i>	<i>[Signature]</i>	<i>80800</i>	<i>17/11/20</i>
<i>28</i>	<i>SURFACE CORROSION ALONG LAP JOINTS ON RH SIDE OF AIRCRAFT BELLY AT FUSELAGE STATION 166.95</i>	<i>CORROSION MECHANICALLY REMOVED. AREAS ALIGNED, PRIMED AND PAINTED. IAW AC 43-13-16 CHAPTER 6 SECTION 7</i>	<i>[Signature]</i>	<i>[Signature]</i>	<i>80800</i>	<i>17/11/20</i>
<i>29</i>	<i>CORRODED RIVETS ON AIRCRAFT BELLY AT F.S. 186-15</i>	<i>CORRODED RIVETS REMOVED AND AREA ALIGNED, PRIMED AND PAINTED. NEW RIVETS INSTALLED IAW AC 43-13-16 CHAPTER 4 SECTION 4 FIG. 4-57</i>	<i>[Signature]</i>	<i>[Signature]</i>	<i>80800</i>	<i>17/11/20</i>

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA 20378

AEROPLANE TYPE 414A

AEROPLANE REGISTRATION VH- JPK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
30	UPPER AND LOWER ELEVATOR CABLE REAR BULKHEAD PRESSURE SEALS O/S.	NEW SEALS + ATTACHING H/WARE FITTED IAW 414A SIM SECT G ELEVATOR CONTROL SYSTEM.			50800	26/11/2020
31	LH PAX #1 O/R SEAT BELT TO BE REPAIRED.	LH PAX #1 O/R LAP BELT REMOVED. LH PAX #1 O/R LAP BELT PN: L100-7 SN: 111516 REPAIRED BY ARCHERWOOD PTY LTD. ARC 030/111516 REFERS. LH PAX #1 O/R LAP BELT REINSTALLED WRT 414A IPC CHAPTER 25-20-00			50800	20/11/20
32	PILOT SEAT FWD 1/R SEAT ROLLER ASSY. CRACKED.	PILOT FWD 1/R SEAT BRACKET ASSY. REMOVED. CRACK REPAIRED BY AVIATION WELDING ARC # 20/327 REFERS. PILOT FWD 1/R SEAT ROLLER BRACKET REINSTALLED. IAW AC 43.13-16 CH.4 SECT. 4 FIG. 4-57.			50800	20/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed. Co-ordinating Certification (if required). For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature: Licence Number: Date:
 Form RAP / 001C Rev: Initial Date: Nov. 2013

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20378

AEROPLANE TYPE CH4A

AEROPLANE REGISTRATION VH- JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE	
33	Cabin Blower Inop	switches placarded and circuit breaker locked out.	<i>[Signature]</i>	<i>[Signature]</i>	515738	17-11-2020	
34	AILERON CONTROL CABLE SYSTEM TURN BARRELS AND AILERON INTERCONNECT ATTACH HARD WARE TO BE INSPECTED FOR SAFETY POST AD/GEN/87 Amnt 1 INSPECTION.	DUPLICATE INSPECTION OF AILERON CONTROL CABLE SYSTEM TURN BARRELS AND AILERON INTERCONNECT ATTACH HARDWARE FOR SAFETY AND INSTALATON C/O.	<div style="border: 1px solid black; padding: 5px;"> <p style="text-align: center; margin: 0;">DUPLICATE INSPECTION CERTIFICATION CARRIED OUT IAW CAR 42G</p> <p>FIRST INSP. SIGN: <i>[Signature]</i> Lic. No: 809298</p> <p>SECOND INSP. SIGN: <i>[Signature]</i> Lic. No: 515594</p> </div>				19/11/20
35	FWD ELEVATOR CONTROL CABLE TURNBARRELS AND CONTROL COLUMN BELLOWSK ATTACH TO BE INSPECTED FOR SAFETY POST AD/GEN/87 Amnt 1 INSPECTION.	DUPLICATE INSPECTION OF ELEVATOR CONTROL CABLE FWD TURNBARRELS AND CONTROL COLUMN BELLOWSK ATTACH FOR INSTALLATION AND SAFETY C/O	<div style="border: 1px solid black; padding: 5px;"> <p style="text-align: center; margin: 0;">DUPLICATE INSPECTION CERTIFICATION CARRIED OUT IAW CAR 42G</p> <p>FIRST INSP. SIGN: <i>[Signature]</i> Lic. No: 809298</p> <p>SECOND INSP. SIGN: <i>[Signature]</i> Lic. No: 515594</p> </div>				19/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RFA00378

AEROPLANE TYPE C414A

AEROPLANE REGISTRATION VH- JTR

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
36	CORRODED RIVETS ON RADDOME RH MID ANCHOR NUT.	CORRODED RIVETS REMOVED AND NEW RIVETS INSTALLED IAW AC-43-13-16 CHAPTER 4 SECTION 4 FIG 4-57	<i>M</i>		<i>5000</i>	19/11/20
37	CORRODED CHERRY MAX RIVETS ON CABIN ENTRANCE DOOR FRAME, FWD UPPER CORNER AND LOWER AFT CORNER	CORRODED RIVETS REMOVED AND NEW RIVETS INSTALLED IAW AC-43-13-16 CHAPTER 4 SECTION 4 FIG 4-57	<i>M</i>		<i>5000</i>	19/11/20
38	SURFACE CORROSION AND CORRODED RIVETS ON EMERGENCY EXIT DOOR FWD AND AFT LOWER CORNERS.	SURFACE CORROSION REMOVED AND AREAS ALIGNED AND PRIMED. IAW AC-43-13-16 CHAPTER 6 SECTION 7. CORRODED RIVETS REINSTALLED IAW AC-43-13-16 CHAPTER 4 SECTION 4 FIG 4-57.	<i>M</i>		<i>5000</i>	19/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature: Licence Number: Date:

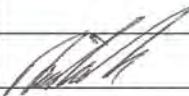

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20375 AEROPLANE TYPE C44A AEROPLANE REGISTRATION VH-JBK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
39	R17 M6- 8 ACTUATOR EXTENSION LINE AN FITTING LEAKING.	AIRCRAFT JACKED 90° AN FITTING REMOVED AND ORING REPLACED. FITTING RESITTED. RETRACTS C/O TO BLEED SYSTEM. NIL DEFECTS FOUND. WORK C/O PAW 4/4A SM SECT 4 MAINTAINING GEAR ACTUATOR AND EXTENSION AND RETRACTION.			<u>8888</u>	<u>22/11/2020</u>

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....
 Form RAP / 001C Rev: Initial Date: Nov. 2013

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA20378

AEROPLANE TYPE C414A

AEROPLANE REGISTRATION VH-JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
40	RH HEAT EXCHANGER CONTROL CABLE DETACHED AT RH HEAT EXCHANGER CONTROL KNOB.	RH HEAT EXCHANGER CONTROL CABLE REATTACHED TO RH HEAT EXCHANGER CONTROL KNOB. WRT 414A IPC CHAPTER 21-30-00 FIG. 09	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i>	18/11/20
41	RH HEAT EXCHANGER INLET AIR VALVE DOOR LOOSE.	RH HEAT EXCHANGER REMOVED. HEAT EXCHANGER INLET AIR VALVE DOOR BUSHINGS REATTACHED. RH HEAT EXCHANGER REINSTALLED IAW 414A AMM SECTION 13, 13-21.	<i>[Signature]</i>	<i>[Signature]</i>	<i>[Signature]</i>	18/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL No. 3404

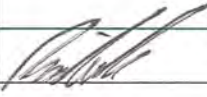

RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER *RAD0378*

AEROPLANE TYPE *C44A*

AEROPLANE REGISTRATION VH- *JRK*

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
<i>42</i>	<i>CORROSION ON LH AND RH FUEL FILLER CAPS</i>	<i>FUEL FILLER CAPS REMOVED AND DISASSEMBLED. CORROSION REMOVED + TREATED. FILLER CAPS PREPPED, PRIMED AND SYNTHESIZED IN RED. FILLER CAPS RE-ASSEMBLED AND FITTED TO AIRCRAFT.</i>			<i>58888</i>	<i>26/11/2020</i>
		<i>WORK C/O LAW 44A SIM SECT 11 MAIN FUEL TANKS AND WITH REFERENCE TO AC43.13-1B CH G SECT 7.</i>				

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.
 Co-ordinating Certification (if required).
 For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....
 Form RAP / 001C Rev: Initial Date: Nov. 2013

12.5 Additional Worksheet - Form RAP / 001C

RAPAIR MAINTENANCE PTY. LTD.
 CERTIFICATE OF APPROVAL NO. 3404



RAPAIR ELECTRICAL & INSTRUMENT SERVICES PTY LTD
 CERTIFICATE OF APPROVAL NUMBER C527115

ADDITIONAL WORKSHEET

JOB NUMBER RA 20378

AEROPLANE TYPE 414A

AEROPLANE REGISTRATION VH- JRK

ITEM	DEFECT OR WORK REQUIRED	RECTIFICATION DETAILS	AME SIGNATURE	LAME SIGNATURE	LIC. NO.	DATE
43	BATTERY U/S	NEW BATTERY COMMISSIONED AND INSTALLED IAW 414A AMM SECTION 14 14-6. BATTERY SN: G03058729	AM		80008	26/11/20
44	LH WING LOCKER DOOR GAS STRUT TO BE REGASSED	LH WING LOCKER DOOR GAS STRUT REGASSED.	AM		80008	26/11/20

A certification in Column 5 above constitutes a certification pursuant to CAR 42ZE that all maintenance has been properly performed.

Co-ordinating Certification (if required).

For and on behalf of RapAir Maintenance Pty. Ltd. I hereby certify for the completion and co-ordination of the entire inspection.

LAME Signature:..... Licence Number:..... Date:.....

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877 FAX: (07) 3274 4331
ABN: 43 055 375 678

Invoice No: 00005195
Date: 20-12-18
Job No: RA19254
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

Description

Amount

CARRY OUT PERIODIC INSPECTION WITH REFERENCE TO CASA
MAINTENANCE SCHEDULES, FULL SIDS COMPLIANCE, AD/GEN/87 #1,
OUTSTANDING AIRWORTHINESS DIRECTIVES AND RECTIFICATIONS.
WORKSHEETS TO FOLLOW.

LABOUR	\$33,250.00
PARTS:	
2 x oil filter	\$97.20
1 x o ring	\$1.70
1 x o ring	\$0.25
1 x o ring	\$0.33
1 x gasket	\$0.96
1 x o ring	\$0.73
1 x o ring	\$0.28
2 x bearing	\$201.60
1 x filter	\$174.60
2 x filter	\$10.36
1 x nipple	\$4.47
1 x sealant	\$281.20
1 x grommet	\$0.73
1 x o ring	\$2.50
1 x o ring	\$7.02
1 x o ring	\$7.78
5 x lifter	\$780.00
7 x lifter	\$1,134.00
6 x piston pin	\$460.62

Terms: COD

Sub Total

E & OE

GST

Parts remain the property of
RAPAIR until paid for.

Invoice Total

Paid to Date

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

Balance Owing

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108

PH: (07) 3277 7877 FAX: (07) 3274 4331
ABN: 43 055 375 678

Invoice No: 00005195

Date: 20-12-18
Job No: RA19254
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

Description	Amount
2 x gasket	\$1.44
1 x gasket	\$2.04
1 x push rod	\$88.02
1 x gasket	\$1.72
2 x nut	\$3.36
1 x vac pump	\$453.60
5 x grommet	\$2.40
1 x grommet	\$0.62
1 x clamp	\$1.14
1 x clamp	\$1.57
1 x clamp	\$76.50
1 x gasket	\$1.34
1 x o ring	\$5.82
1 x o ring	\$5.42
1 x slip joint	\$107.10
1 x o ring	\$1.16
1 x o ring	\$0.34
1 x o ring	\$0.78
1 x nut clip	\$5.62
1 x bolt	\$0.46
1 x bolt	\$0.51
1 x valve cap	\$1.65
1 x sealant	\$37.12
1 x seal	\$24.02
1 x hinge half	\$1,132.38
1 x hinge half	\$1,058.80
1 x gasket	\$4.44

Terms: COD

E & OE

Parts remain the property of
RAPAIR until paid for.

Sub Total

GST

Invoice Total

Paid to Date

Balance Owing

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944
ARCHERFIELD Q 4108
PH: (07) 3277 7877 FAX: (07) 3274 4331
ABN: 43 055 375 678

Invoice No: 00005195
Date: 20-12-18
Job No: RA19254
Ref: VH-JRK

Bill To:

**DALBY MACHINERY CENTRE
P O BOX 438
DALBY QLD 4405**

Description	Amount
2 x nut	\$3.36
1 x gasket	\$1.72
6 x static wick	\$218.16
1 x gasket	\$24.80
2 x o ring	\$0.62
4 x bolt	\$48.54
2 x bolt	\$85.40
10 x nut	\$37.90

AVIONICS:

Carry out radio periodic inspection WRT CASA maintenance schedules. Carry out CAO 100.5 transponder and altitude encoder inspections - altitude encoder calibrations out of tolerance, adjustment procedure carried out and final test operational.

Transponder removed and bench tested - frequency correction carried out and refitted to aircraft. \$369.00

ELECTRICAL & INSTRUMENT:

Carry out electrical & instrument periodic inspection WRT CASA maintenance schedules. Replacement vacuum system filters fitted. Carried out CAO 100.5 inspections, pilot and co pilot pitot and static systems within tolerance.

Both pilot and co pilot static systems extensive repairs carried out to both pilot and co pilot static systems, replacement autopilot airspeed switch and static lines and components replaced as required.

FAR 43 App E inspection carried out on both altimeters and refit. Repaired damaged wiring in wing root, tail and nose areas. Reterminated both fire bottle wiring after refit. Carried out cabin altitude warning Baro switch test -

Terms: COD

E & OE

Parts remain the property of
RAPAIR until paid for.

Sub Total

GST

Invoice Total

Paid to Date

Balance Owing

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.

RAPAIR MAINTENANCE PTY LTD

PO Box 944

ARCHERFIELD Q 4108

PH: (07) 3277 7877 FAX: (07) 3274 4331

ABN: 43 055 375 678

Invoice No: 00005195

Date: 20-12-18

Job No: RA19254

Ref: VH-JRK

Bill To:

DALBY MACHINERY CENTRE

P O BOX 438

DALBY QLD 4405

Description	Amount
test passed and switch refitted. Remove battery for service/recharge and refit. Carried out heater inspection - heater tested operational but hour meter u/s, replacement hour meter fitted. Carry out repairs to wing tip and nav lighting. Traced RH alternator fault and repaired. Carried out alternator parallel procedure.	\$3,919.23
OTHER SERVICES:	
Eddy current inspection for SIDS.	\$312.00
Eddy current inspection to verify cracking in fuselage stringer.	\$424.40
Overhaul, hydrostatical test required on blow down bottle.	\$2,061.88
Weld repair RH tailpipe & waste gate overboard pipe.	\$1,884.00
Repair gas strut as required.	\$72.00
Manufacture Qty 1 rudder cable.	\$323.04
Repair turbo charger as necessary and test.	\$3,999.80
Repair Qty 2 VAPC as required and test.	\$1,187.00
OIL	\$210.00
CONSUMABLES	\$831.25

Terms: COD

E & OE

Parts remain the property of
RAPAIR until paid for.

BANKING DETAILS: ANZ

BSB # 014 202 A/C # 267 754 928

Account Name: RapAir Maintenance Pty Ltd

Sub Total \$55,449.80

GST \$5,544.98

Invoice Total \$60,994.78

Paid to Date \$0.00

Balance Owing \$60,994.78

NOTE: Administration fee of 1.5% applies for Visa/Mastercard payments.